


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10033082		Main Street: NORTH_REA_PARK_LN		Cross Street: N/A		Location: SW									
ADA ID: 39CA4EF1B1F8		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 5							
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance											
 Possible Solutions: Remove & Replace Entire Ramp. Remove & Replace Gutter. Surveyor Notes: N/A PROW/ADA: R304.5.3, R304.5.4				Compliance		Description		Data		Compliance		Description		Data	
				N/A		Ramp Length (in)		91.5		Yes		Grade Break?		Yes	
				Yes		Ramp Width (in)		95.0		No		Grade Break Slope (%)		7.8	
				Yes		Ramp Slope (%)		2.2		Yes		Grade Break XSlope (%)		1.0	
				Yes		Ramp XSlope (%)		1.3							
				Yes		Flare Type LT		N/A		Yes		Flare Type RT		N/A	
				N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		N/A	
				N/A		Flare Traversable LT?		No		N/A		Flare Traversable RT?		No	
				Yes		Landing Length (in)		57.0		Yes		DWS Provided?		Yes	
				Yes		Landing Width (in)		96.0		Yes		DWS Contrast?		Yes	
Yes		Landing Slope (%)		0.2		Yes		DWS Length (in)		24.0					
Yes		Landing X Slope (%)		0.9		Yes		DWS Full Width?		Yes					
N/A		Landing Curb? (Y/N)		No		Yes		DWS Offset LT (in)		1.0					
N/A		Shared Landing?		No		Yes		DWS Offset RT (in)		5.0					
Yes		Gutter Ponding?		No		No		Gutter Slope (%)		5.4					
Yes		Gutter Lip Ht (in)		0.0		Yes		Gutter X Slope (%)		1.4					
N/A		Painted X Walk1?		No				Road Slope (%)		3.2					
		X Walk 1 Direction		To N				Road X Slope (%)		1.1					
		X Walk 1 Width (in)		N/A				Clear Space?		Yes					
		X Walk 1 Slope (%)		3.2		N/A		Clear Space to XWalk (in)		N/A					
		X Walk 1 X Slope (%)		1.1		Yes		Storm Grate/Utility Hazard?		No					
N/A		Ramp inside XWalk1?		N/A				Storm Grate/Utility Type							
Yes		Any Obstructions?		No						N/A					
		Obstruction Type				Yes		Surface Condition? (G/P)		Good					
						N/A		Yes		Curb Slope (%)		8.1			
Total Cost:				\$		2350.00									

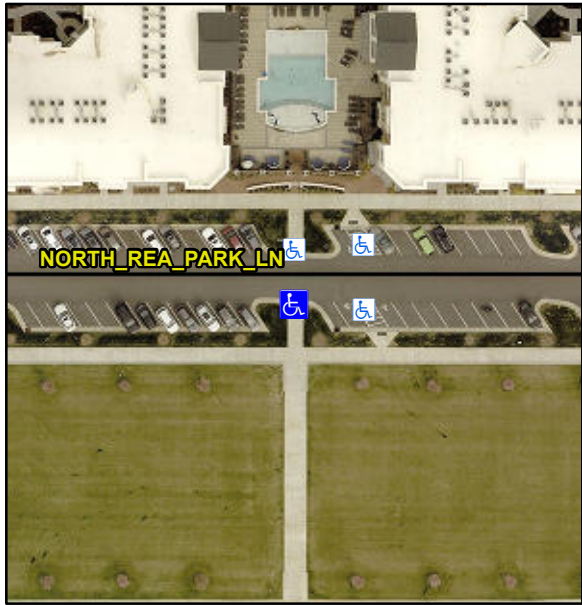