

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 13389	Main Street: ELIZABETH_AV	Cross Street: N_KINGS_DR	Location: N
ADA ID: 3AAFE78FB7ED	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

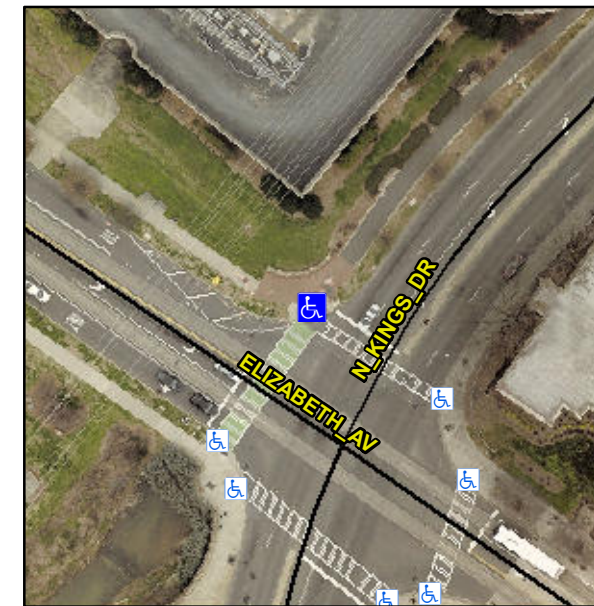

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	5.3
Yes	Ramp Width (in)	154.0	Yes	Ramp XSlope (%)	1.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.0	Yes	Flare Slope RT (%)	3.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	154.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	13.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	6.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.6
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	136.0	N/A	X Walk 2 Width (in)	82.0
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	1.3
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	0.3	N/A	Clear Space?	Yes
	Road X Slope (%)	1.4	Yes	Clear Space to XWalk (in)	48.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name ELIZABETH AV
 Stop Condition-Street 2 Signal
 Street 2 Name N KINGS DR
 Stop Condition-Street 1 Signal

