

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 47833 Main Street: TOM_SHORT_RD Cross Street: SPUR_RANCH_RD Location: N

ADA ID: 3AB488A3B1F4 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 8.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

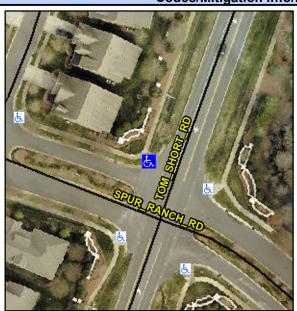

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

SPUR RANCH RD
StopSign
TOM SHORT RD
None

Possible Solutions:

Remove & Replace Curb Ramp With
Two New Directional Ramps or
Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1

Total Cost: \$ 3200.00

Field Measurements/Component Compliance						
	Compliance Description		Data	Compliance Description		Data
	N/A	Ramp Length (in)	106.0	Yes	Ramp Slope (%)	5.9
	No	Ramp Width (in)	45.0	Yes	Ramp XSlope (%)	0.5
	N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
	N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
	N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
	N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
	N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
	N/A	Shared Landing?	N/A			
	N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
	N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
	N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
		X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
	N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
		X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	3.2
		X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	0.3
	N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	1.1	N/A	Clear Space?	N/A
		Road X Slope (%)	3.5	N/A	Clear Space to XWalk (in)	N/A
				l		

N/A N/A

N/A

Storm Grate/Utility Hazard?

Storm Grate/Utility Type

Surface Condition? (G/P)

N/A

N/A

Good







N/A

Any Obstructions?

Obstruction Type