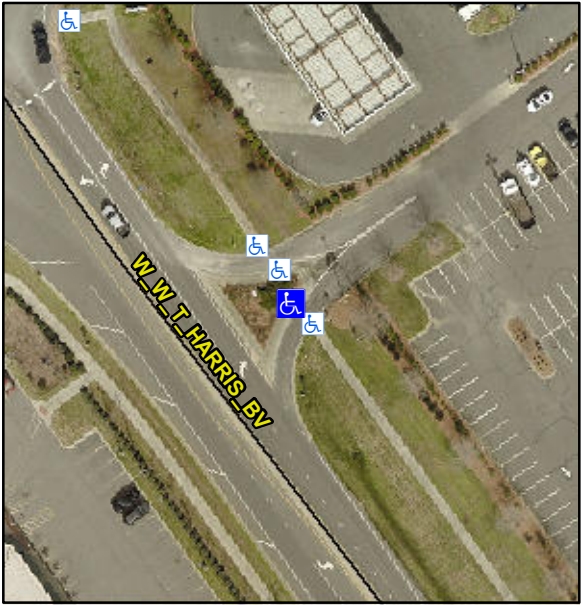


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: W_W_T_HARRIS_BV	Cross Street: N/A	Location: E
ADA ID: 3AFA4CD148F0	Ramp Type: IslandPerp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

	Possible Solutions:			
	Remove & Replace Entire Ramp.			
	Surveyor Notes:			
	N/A			
	PROW/ADA:			
	Not Found, R304.2.2			
		Compliance	Description	Data
		N/A	Ramp Length (in)	70.0
		Yes	Ramp Width (in)	62.0
		N/A	Flare Type LT	N/A
		N/A	Flare Slope LT (%)	N/A
		N/A	Flare Traversable LT?	N/A
		N/A	Landing Length (in)	N/A
		N/A	Landing Width (in)	N/A
		N/A	Landing Slope (%)	N/A
		N/A	Landing X Slope (%)	N/A
		N/A	Landing Curb? (Y/N)	N/A
		N/A	Shared Landing?	N/A
		N/A	Gutter Ponding?	N/A
		N/A	Gutter Lip Ht (in)	N/A
		N/A	Painted X Walk1?	No
			X Walk 1 Direction	To S
		N/A	X Walk 1 Width (in)	N/A
			X Walk 1 Slope (%)	0.3
			X Walk 1 X Slope (%)	5.4
		N/A	Ramp inside XWalk1?	N/A
			Road Slope (%)	N/A
			Road X Slope (%)	N/A
		N/A	Any Obstructions?	N/A
			Obstruction Type	
				N/A
		Yes	Surface Condition? (G/P)	Good

Street 1 Name	ENTRANCE
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 3400.00

