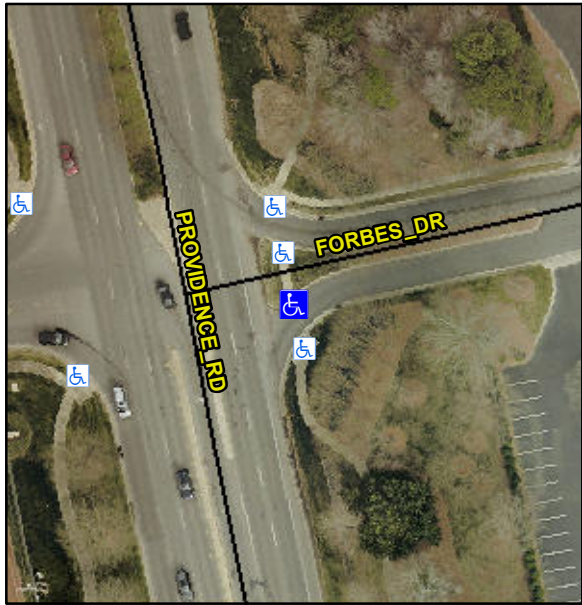


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 27211	Main Street: FORBES_DR	Cross Street: PROVIDENCE_RD	Location:	N
ADA ID: 3B400EC266D2	Ramp Type: MedianPerp	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 10

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance									
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>			
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)		<b>48.0</b>		<b>Yes</b>	Ramp Slope (%)		<b>7.7</b>	
			<b>Yes</b>	Ramp Width (in)		<b>60.0</b>		<b>Yes</b>	Ramp XSlope (%)		<b>0.4</b>	
			<b>N/A</b>	Flare Type LT		<b>None</b>		<b>N/A</b>	Flare Type RT		<b>N/A</b>	
			<b>N/A</b>	Flare Slope LT (%)		<b>N/A</b>		<b>N/A</b>	Flare Slope RT (%)		<b>N/A</b>	
			<b>N/A</b>	Flare Traversable LT?		<b>N/A</b>		<b>N/A</b>	Flare Traversable RT?		<b>N/A</b>	
			<b>Yes</b>	Landing Length (in)		<b>53.0</b>		<b>No</b>	DWS Provided?		<b>No</b>	
			<b>Yes</b>	Landing Width (in)		<b>60.0</b>		<b>N/A</b>	DWS Contrast?		<b>No</b>	
			<b>Yes</b>	Landing Slope (%)		<b>0.8</b>		<b>N/A</b>	DWS Length (in)		<b>N/A</b>	
			<b>No</b>	Landing X Slope (%)		<b>4.3</b>		<b>N/A</b>	DWS Full Width?		<b>No</b>	
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.3, R305</b></p>			<b>N/A</b>	Landing Curb? (Y/N)		<b>N/A</b>		<b>N/A</b>	DWS Offset (in)		<b>N/A</b>	
			<b>N/A</b>	Shared Landing?		<b>No</b>						
			<b>Yes</b>	Gutter Ponding?		<b>No</b>		<b>Yes</b>	Gutter Slope (%)		<b>0.4</b>	
			<b>Yes</b>	Gutter Lip Ht (in)		<b>0.0</b>		<b>Yes</b>	Gutter X Slope (%)		<b>1.5</b>	
			<b>N/A</b>	Painted X Walk1?		<b>No</b>		<b>N/A</b>	Painted X Walk2?		<b>N/A</b>	
				X Walk 1 Direction		<b>To S</b>			X Walk 2 Direction		<b>N/A</b>	
			<b>N/A</b>	X Walk 1 Width (in)		<b>N/A</b>		<b>N/A</b>	X Walk 2 Width (in)		<b>N/A</b>	
				X Walk 1 Slope (%)		<b>0.8</b>			X Walk 2 Slope (%)		<b>N/A</b>	
				X Walk 1 X Slope (%)		<b>0.7</b>			X Walk 2 X Slope (%)		<b>N/A</b>	
			<b>N/A</b>	Ramp inside XWalk1?		<b>N/A</b>		<b>N/A</b>	Ramp inside XWalk2?		<b>N/A</b>	
<p>Total Cost:</p> <p><b>\$ 1650.00</b></p>				Road Slope (%)		<b>N/A</b>		<b>N/A</b>	Clear Space?		<b>Yes</b>	
				Road X Slope (%)		<b>N/A</b>		<b>N/A</b>	Clear Space to XWalk (in)		<b>N/A</b>	
			<b>Yes</b>	Any Obstructions?		<b>No</b>		<b>Yes</b>	Storm Grate/Utility Hazard?		<b>No</b>	
				Obstruction Type					Storm Grate/Utility Type			
						<b>N/A</b>					<b>N/A</b>	
								<b>Yes</b>	Surface Condition? (G/P)		<b>Good</b>	

