


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 28141	Main Street: PROVIDENCE_RD_WEST	Cross Street: OLD_ARDREY_KELL_RD	Location: NW
ADA ID: 3B90F7AC71CF	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5	

Codes/Mitigation Info/Possible Solution	Field Measurements/Component Compliance
---	---

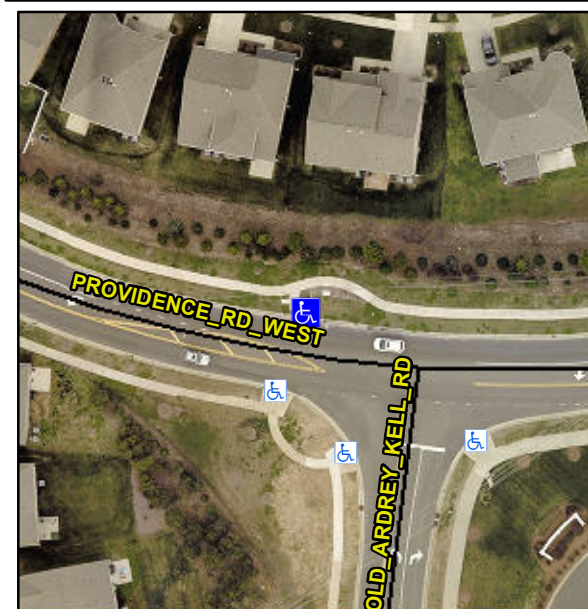

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.5.4

Street 1 Name	PROVIDENCE RD WEST
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	56.0	Yes	BlendTrans Slope (%)	1.9
Yes	Ramp Width (in)	59.0	Yes	BlendTrans XSlope (%)	0.4
N/A	Flare Type LT	None	N/A	Flare Type RT	None
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
No	Landing Length (in)	43.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	9.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.3		Clear Space?	Yes
	Road X Slope (%)	9.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	11.0

