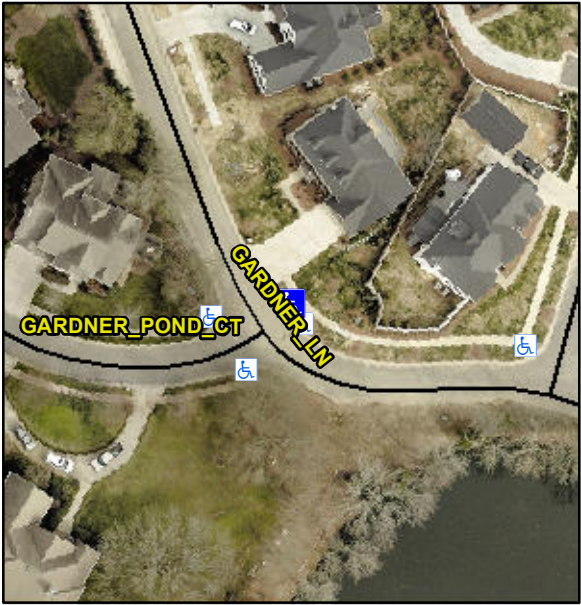


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 46360	Main Street: GARDNER_LN	Cross Street: GARDNER_POND_CT	Location: NE
ADA ID: 3B9752FE7175	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
 <p>Street 1 Name GARDNER POND LN</p> <p>Stop Condition-Street 2 None</p> <p>Street 2 Name N/A</p> <p>Stop Condition-Street 1 N/A</p>	<p>Possible Solutions:</p> <p>Remove & Replace Entire Ramp.</p> <p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2</p>	<p>Compliance</p> <p>Description</p> <p>Data</p>	<p>Compliance</p> <p>Description</p> <p>Data</p>				
		N/A	Ramp Length (in)	96.0	No	Ramp Slope (%)	12.1
		Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	3.5
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
			X Walk 1 Direction	To W		X Walk 2 Direction	N/A
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	3.6		X Walk 2 Slope (%)	N/A
			X Walk 1 X Slope (%)	4.6		X Walk 2 X Slope (%)	N/A
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	N/A	N/A	Clear Space?	N/A
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
Total Cost:		\$	1850.00				

