


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5877		Main Street: COULWOOD_DR		Cross Street: N/A		Location: E			
ADA ID: 3BA0F3AB5F26		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 2.5	
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance					
<div></div> <div>Possible Solutions:</div> <div>Remove & Replace Entire Ramp.</div> <div>Surveyor Notes:</div> <div>NO CURB</div> <div>PROW/ADA:</div> <div>R304.2.1, R304.5.3, R305.1.4, R305.2</div> <div><div>Street 1 Name</div><div>WYNDALE TR</div><div>Stop Condition-Street 1</div><div>StopSign</div><div>Street 2 Name</div><div>N/A</div><div>Stop Condition-Street 2</div><div>N/A</div></div> <div>Total Cost: \$ 1600.00</div>				Compliance	Description	Data	Compliance	Description	Data
				N/A	Ramp Length (in)	54.0	Yes	Grade Break?	Yes
				Yes	Ramp Width (in)	60.0	Yes	Grade Break Slope (%)	1.1
				Yes	Ramp Slope (%)	6.0	No	Grade Break XSlope (%)	2.4
				Yes	Ramp XSlope (%)	0.6			
				N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
				N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
				N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
				No	Landing Length (in)	44.0	Yes	DWS Provided?	Yes
				Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
				Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
				Yes	Landing X Slope (%)	0.7	No	DWS Full Width?	No
				N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	10.0
				N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	10.0
				Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
				Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
				N/A	Painted X Walk1?	No		Road Slope (%)	0.3
					X Walk 1 Direction	To SW		Road X Slope (%)	4.0
					X Walk 1 Width (in)	N/A		Clear Space?	Yes
					X Walk 1 Slope (%)	0.3	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)	4.0	Yes	Storm Grate/Utility Hazard?	No
				N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
				Yes	Any Obstructions?	No			N/A
					Obstruction Type		Yes	Surface Condition? (G/P)	Good
							N/A	Curb Slope (%)	N/A

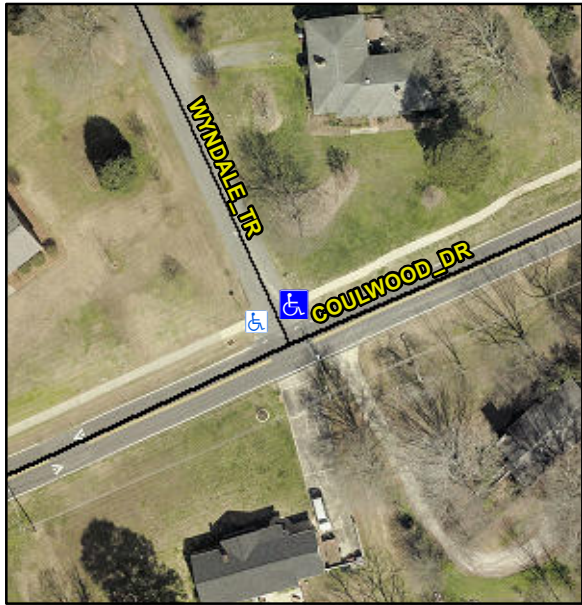