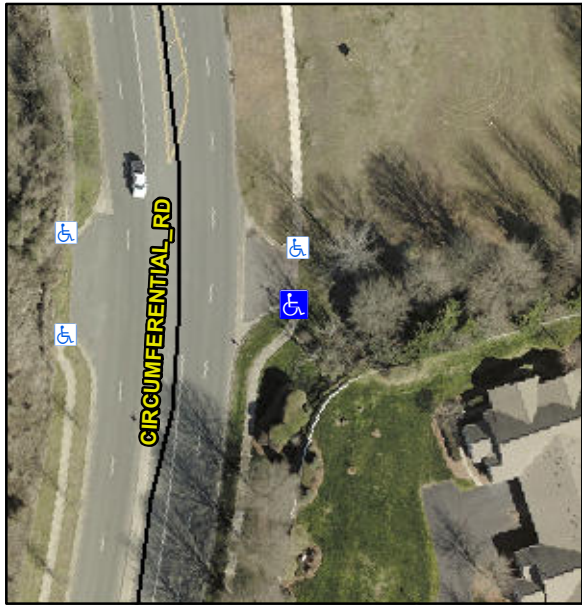


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10023486	Main Street: CIRCUMFERENTIAL_RD	Cross Street: N/A	Location: SE
ADA ID: 3BAFADE1E181	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 2.5			

	Possible Solutions:		Compliance		Description	Data	Compliance		Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	28.0	Yes	Ramp Slope (%)	6.2		
	Remove & Replace Gutter.		Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.0		
			N/A	Flare Type LT	None	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			Yes	Landing Length (in)	53.0	Yes	DWS Provided?	Yes		
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes		
			Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0		
			No	Landing X Slope (%)	2.4	No	DWS Full Width?	No		
Surveyor Notes: N/A PROW/ADA: R304.5.3, R305.1.4			N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.5		
			N/A	Shared Landing?	No					
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.5		
			Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.8		
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
				X Walk 1 Direction	To N		X Walk 2 Direction	N/A		
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	5.0		X Walk 2 Slope (%)	N/A		
				X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A		
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
Street 1 Name ENTRANCE Stop Condition-Street 2 None Street 2 Name N/A Stop Condition-Street 1 N/A				Road Slope (%)	N/A	N/A	Clear Space?	Yes		
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
			Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
				Obstruction Type			Storm Grate/Utility Type			
						N/A		N/A		
						Yes	Surface Condition? (G/P)	Good		
Total Cost:		\$	2600.00							

