


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 8746 Main Street: GENERAL_COMMERCE_DR Cross Street: INDUSTRIAL_CENTER_CR Location: N

ADA ID: 3C7C04B9FDCE Ramp Type: Perp Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 12.5

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

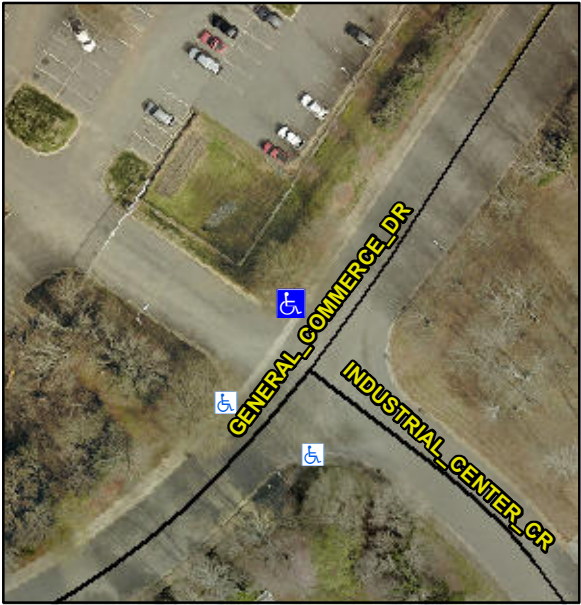

Possible Solutions:
Remove & Replace Entire Ramp.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.2.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	58.0	No	Ramp Slope (%)	8.5
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.3
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	Yes	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	8.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 1850.00

Street 1 Name **INDUSTRIAL CENTER DR**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **N/A**
 Stop Condition-Street 1 **N/A**

