


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                           |                                         |                        |
|-----------------------------------------|---------------------------|-----------------------------------------|------------------------|
| Intersection ID: 10018981               | Main Street: DEVONGATE_LN | Cross Street: DEVONGATE_LN              | Location: NW           |
| ADA ID: 3C904330034B                    | Ramp Type: PerpDiag       | Initial Pass/Fail: Fail                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                           | Field Measurements/Component Compliance |                        |

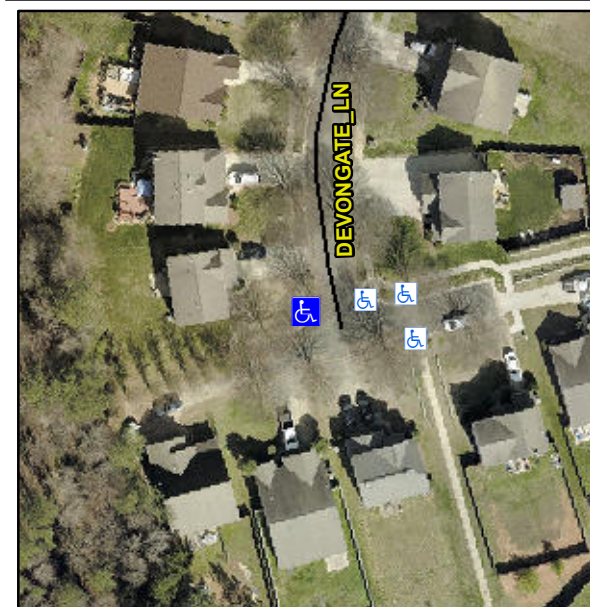

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3**

|                         |              |
|-------------------------|--------------|
| Street 1 Name           | DEVONGATE LN |
| Stop Condition-Street 2 | None         |
| Street 2 Name           | DEVONGATE LN |
| Stop Condition-Street 1 | None         |

Total Cost: \$ 3200.00

| Compliance | Description           | Data | Compliance | Description                 | Data |
|------------|-----------------------|------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 58.0 | Yes        | Ramp Slope (%)              | 6.4  |
| No         | Ramp Width (in)       | 34.5 | No         | Ramp XSlope (%)             | 3.6  |
| N/A        | Flare Type LT         | N/A  | N/A        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A  | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | N/A  | N/A        | Flare Traversable RT?       | N/A  |
| N/A        | Landing Length (in)   | N/A  | N/A        | DWS Provided?               | N/A  |
| N/A        | Landing Width (in)    | N/A  | N/A        | DWS Contrast?               | N/A  |
| N/A        | Landing Slope (%)     | N/A  | N/A        | DWS Length (in)             | N/A  |
| N/A        | Landing X Slope (%)   | N/A  | N/A        | DWS Full Width?             | N/A  |
| N/A        | Landing Curb? (Y/N)   | N/A  | N/A        | DWS Offset (in)             | N/A  |
| N/A        | Shared Landing?       | N/A  |            |                             |      |
| N/A        | Gutter Ponding?       | N/A  | N/A        | Gutter Slope (%)            | N/A  |
| N/A        | Gutter Lip Ht (in)    | N/A  | N/A        | Gutter X Slope (%)          | N/A  |
| N/A        | Painted X Walk1?      | No   | N/A        | Painted X Walk2?            | No   |
|            | X Walk 1 Direction    | To S |            | X Walk 2 Direction          | To E |
| N/A        | X Walk 1 Width (in)   | N/A  | N/A        | X Walk 2 Width (in)         | N/A  |
|            | X Walk 1 Slope (%)    | 0.5  |            | X Walk 2 Slope (%)          | 2.9  |
|            | X Walk 1 X Slope (%)  | 1.8  |            | X Walk 2 X Slope (%)        | 0.2  |
| N/A        | Ramp inside XWalk1?   | N/A  | N/A        | Ramp inside XWalk2?         | N/A  |
|            | Road Slope (%)        | 0.5  | N/A        | Clear Space?                | N/A  |
|            | Road X Slope (%)      | 1.9  | N/A        | Clear Space to XWalk (in)   | N/A  |
| N/A        | Any Obstructions?     | N/A  | N/A        | Storm Grate/Utility Hazard? | N/A  |
|            | Obstruction Type      |      |            | Storm Grate/Utility Type    |      |
|            |                       | N/A  |            |                             | N/A  |
|            |                       |      | Yes        | Surface Condition? (G/P)    | Good |

