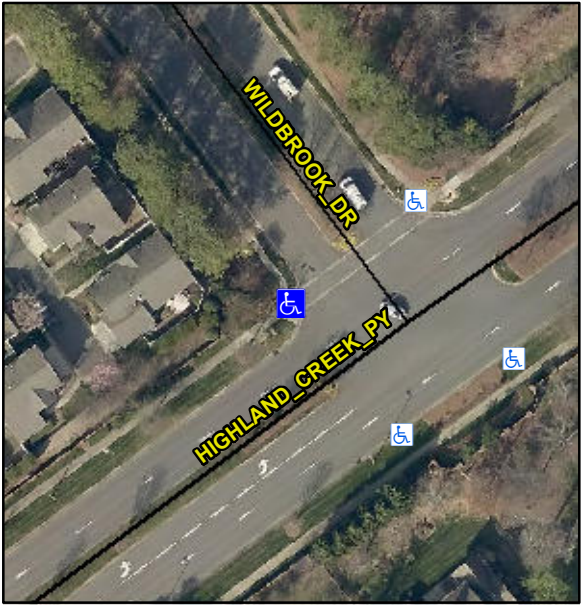



Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 2475	Main Street: HIGHLAND_CREEK_PY	Cross Street: WILDBROOK_DR	Location: W
ADA ID: 3CD8F8E87189	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 21.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Yes	Ramp Length (in)	60.0
			No	Ramp Width (in)	36.5
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
				X Walk 1 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.9
				X Walk 1 X Slope (%)	1.4
			N/A	Ramp inside XWalk1?	N/A
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.1, R304.5.3			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Gutter Slope (%)	N/A
			N/A	Gutter X Slope (%)	N/A
			No	Painted X Walk2?	N/A
				X Walk 2 Direction	To E
			N/A	X Walk 2 Width (in)	N/A
				X Walk 2 Slope (%)	0.4
				X Walk 2 X Slope (%)	2.9
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	N/A
			N/A	Clear Space to XWalk (in)	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
Total Cost:		\$ 3200.00			

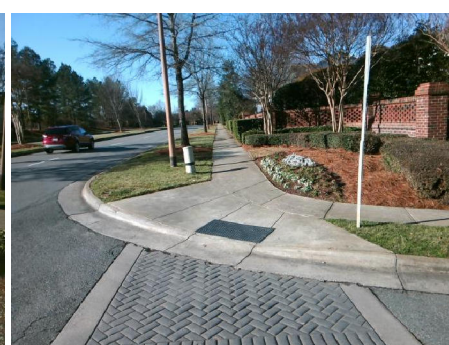

Street 1 Name **HIGHLAND CREEK PY**

Stop Condition-Street 2 **None**

Street 2 Name **WILLOWBROOK DR**

Stop Condition-Street 1 **StopSign**