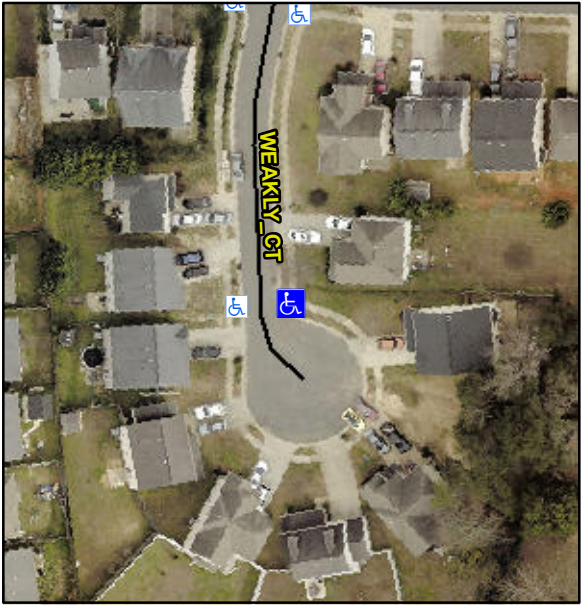


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10041177	Main Street: WEAKLY_CT	Cross Street: N/A	Location:	N
ADA ID: 3CE36551CB2E	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	48.0
			No	Ramp Width (in)	43.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.1</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To SW
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.5
				X Walk 1 X Slope (%)	0.0
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name	WEAKLY CT
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

