

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: INDEPENDENCE_RD	Cross Street: N/A	Location: E
ADA ID: 3D152EE856D7	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 10	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

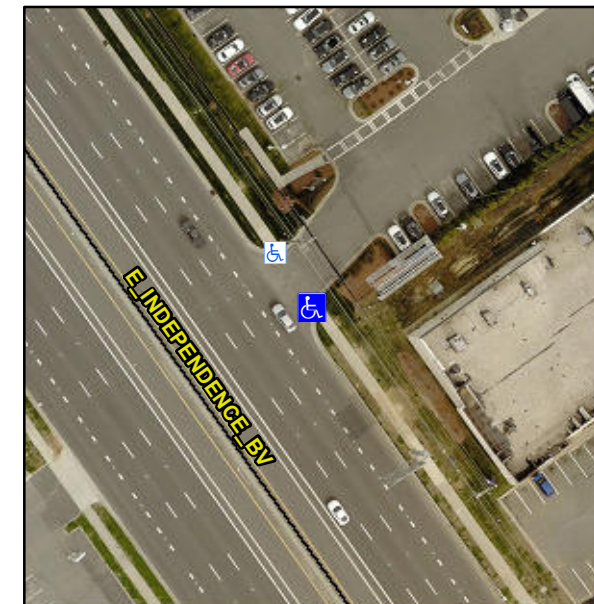

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	No	Grade Break?	No
Yes	Ramp Width (in)	72.0	N/A	Grade Break Slope (%)	3.5
Yes	Ramp Slope (%)	3.8	N/A	Grade Break XSlope (%)	0.1
Yes	Ramp XSlope (%)	0.7			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	64.0	No	DWS Provided?	No
Yes	Landing Width (in)	72.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	3.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	0.8	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	No	N/A	DWS Offset RT (in)	N/A
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.1
N/A	Painted X Walk1?	No		Road Slope (%)	1.4
	X Walk 1 Direction	To NW		Road X Slope (%)	1.1
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.1	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	12.5

Total Cost: \$ 1600.00

Street 1 Name	ENTRANCE
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

