


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 19457	Main Street: S_TRYON_ST	Cross Street: YORKDALE_DR	Location: NW
ADA ID: 3D205B7AE61E	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No Severity Score: 22.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

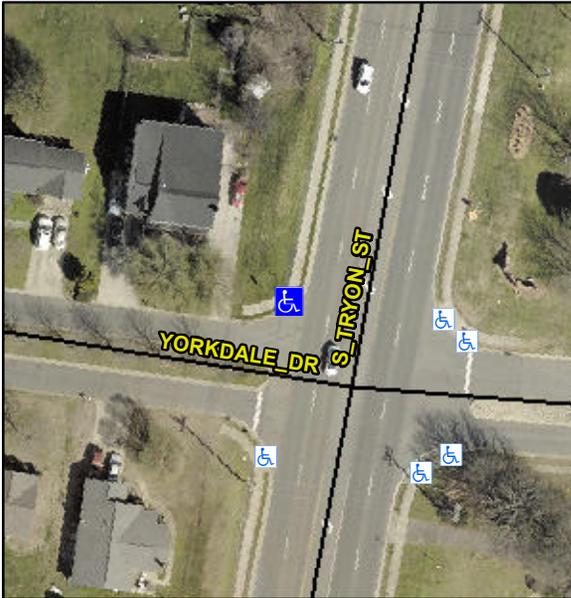

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.2.3, R305

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	91.0	Yes	Ramp Slope (%)	7.7
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.6
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.6	No	Flare Slope RT (%)	11.2
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	No	DWS Provided?	No
No	Landing Width (in)	N/A	N/A	DWS Contrast?	No
No	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	N/A	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.4
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.1		X Walk 2 Slope (%)	0.6
	X Walk 1 X Slope (%)	2.2		X Walk 2 X Slope (%)	0.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.6	N/A	Clear Space?	Yes
	Road X Slope (%)	3.8	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

Street 1 Name **YORKDALE DR**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **S TRYON ST**
 Stop Condition-Street 1 **None**

