


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

| | | | |
|------------------------|---------------------------|-------------------------------|------------------------|
| Intersection ID: 43988 | Main Street: N_HOSKINS_RD | Cross Street: TUCKERS_GLEN_LN | Location: N |
| ADA ID: 3D7B901BA027 | Ramp Type: PerpDiag | Initial Pass/Fail: Fail | Overall Compliance: No |
| | | | Severity Score: 21.25 |

| Codes/Mitigation Info/Possible Solution | Field Measurements/Component Compliance |
|---|---|
|---|---|

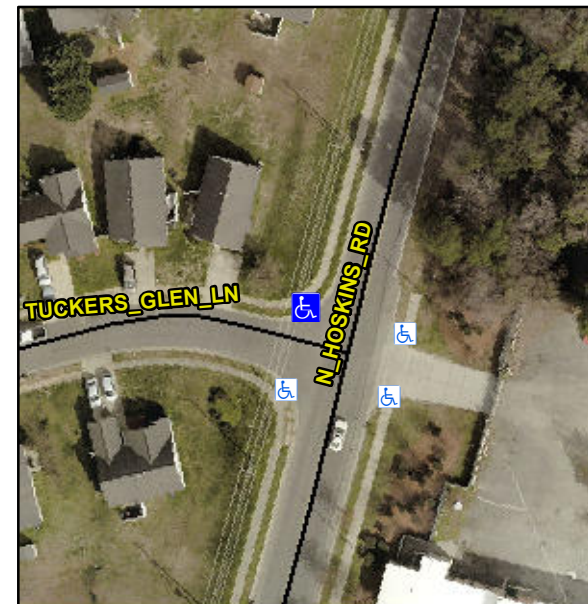

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.2.2

Street 1 Name **TUCKERS GLEN LN**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **N HOSKINS RD**
 Stop Condition-Street 1 **None**

Total Cost: \$ **3200.00**

| Compliance | Description | Data | Compliance | Description | Data |
|------------|-----------------------|-------|------------|-----------------------------|-------|
| N/A | Ramp Length (in) | 84.5 | No | Ramp Slope (%) | 8.6 |
| No | Ramp Width (in) | 36.5 | Yes | Ramp XSlope (%) | 1.2 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | No |
| | X Walk 1 Direction | To SW | | X Walk 2 Direction | To SE |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 4.2 | | X Walk 2 Slope (%) | 0.2 |
| | X Walk 1 X Slope (%) | 1.7 | | X Walk 2 X Slope (%) | 2.6 |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | 2.3 | N/A | Clear Space? | N/A |
| | Road X Slope (%) | 4.1 | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |

