

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: BRYANT_FARMS_RD	Cross Street: KINGSTON_FOREST_DR	Location: SW
ADA ID: 3D86C021D30F	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

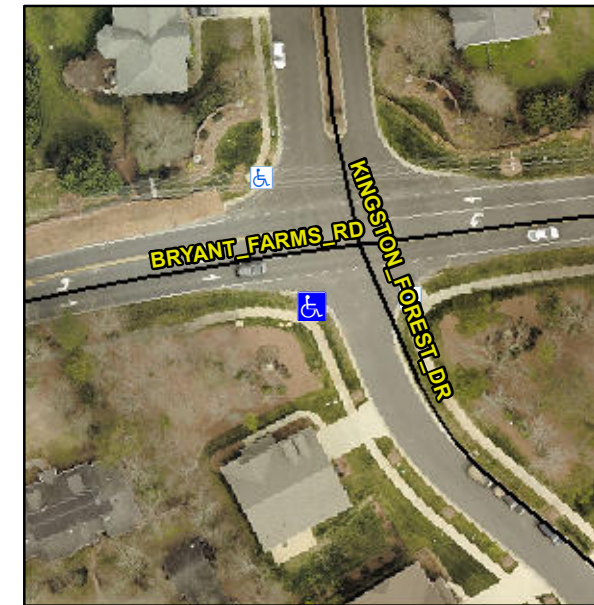

Possible Solutions:

**Remove & Replace Detectable Warning System.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.2**

Total Cost:

**\$ 800.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	97.0	Yes	Ramp Slope (%)	5.8
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	2.6	Yes	Flare Slope RT (%)	6.7
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	5.1
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	0.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0	N/A	Clear Space?	Yes
	Road X Slope (%)	4.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **KINGSTON FOREST DR**  
 Stop Condition-Street 2 **StopSign**  
 Street 2 Name **BRYANT FARMS RD**  
 Stop Condition-Street 1 **None**

