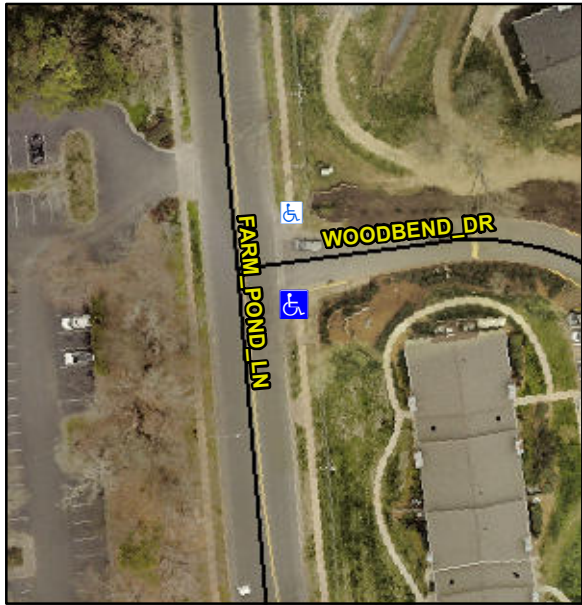


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15491	Main Street: FARM_POND_LN	Cross Street: WOODBEND_DR	Location: SE
ADA ID: 3DD29E1A819E	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	69.0	Yes	Ramp Slope (%)	6.7
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.8
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	8.6	Yes	Flare Slope RT (%)	5.1
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
			No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
			No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
			No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
	Surveyor Notes:		N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
	PROW/ADA:		N/A	Shared Landing?	N/A			
	Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4		Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.8
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To N		X Walk 2 Direction	To W
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	1.2
				X Walk 1 X Slope (%)	1.3		X Walk 2 X Slope (%)	0.5
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.9	N/A	Clear Space?	Yes	
			Road X Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A	
		Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No	
			Obstruction Type			Storm Grate/Utility Type		
					N/A			N/A
					Yes	Surface Condition? (G/P)	Good	

