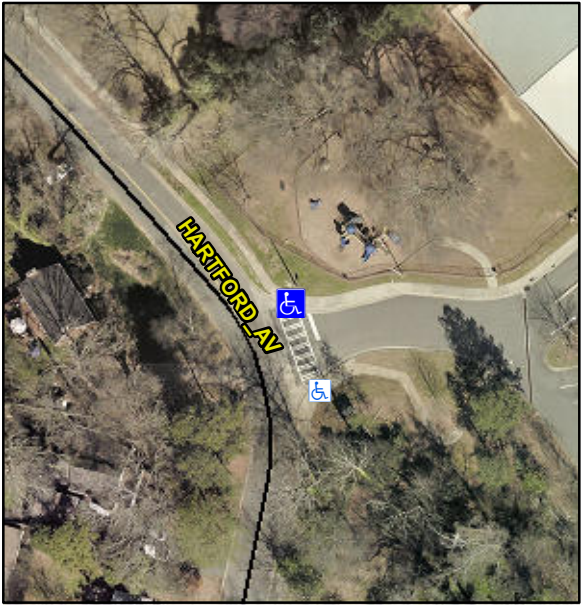


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10028048	Main Street: HARTFORD_AV	Cross Street: N/A	Location: NE
ADA ID: 3E70A3A11071	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance					
	Possible Solutions:						
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.						
	Surveyor Notes:						
	LT RP < 5%						
	PROW/ADA:						
	R304.5.3, R304.3.2						
Street 1 Name	HARTFORD AV						
Stop Condition-Street 1	None						
Street 2 Name	ENTRANCE						
Stop Condition-Street 2	StopSign						
Total Cost:		\$	3200.00				

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	60.0	N/A	Ramp Length RT (in)	63.0
Yes	Ramp Width LT (in)	60.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	1.6	No	Ramp Slope RT (%)	12.3
No	Ramp XSlope LT (%)	2.6	Yes	Ramp XSlope RT (%)	1.7
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	112.0
	X Walk 1 Slope (%)	8.0		X Walk 2 Slope (%)	0.0
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	8.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	5.5	N/A	Clear Space?	N/A
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.6

