


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 28375 Main Street: CORNWALLIS_HALL_DR Cross Street: WHEATFIELD_RD Location: NE **Overall Compliance: No Severity Score: ADA ID: 3ED1FA8F9235** Ramp Type: Perp Initial Pass/Fail: Fail 25

Codes/Mitigation Info/Possible Solution

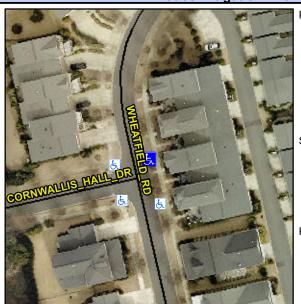

Street 1 Name	WHEATFIELD RD
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Possible Solutions:	Col
Remove & Replace Entire Ramp.	N/A
•	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
Not Found, R304.2.2	N/A
,	N/A
	N/A
	N/A

Total Cost:	\$ 1850.00

Field Measurements/Component Compliance								
Comp	liance Description	Data	Comp	liance Description	Data			
N/A	Ramp Length (in)	72.0	No	Ramp Slope (%)	12.3			
Yes	Ramp Width (in)	50.0	Yes	Ramp XSlope (%)	0.8			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A			
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A			
N/A	Shared Landing?	N/A						
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A			
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A			
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A			
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	N/A			
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A			
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A			
	Road Slope (%)	N/A	N/A	Clear Space?	N/A			
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A			
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A			
	Obstruction Type			Storm Grate/Utility Type				
		N/A			N/A			
			Yes	Surface Condition? (G/P)	Good			





