

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 7969	Main Street: BROOKSHIRE BV	Cross Street: N_HOSKINS_RD	Location: NW
ADA ID: 3EF5BCB4F7F1	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 26.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

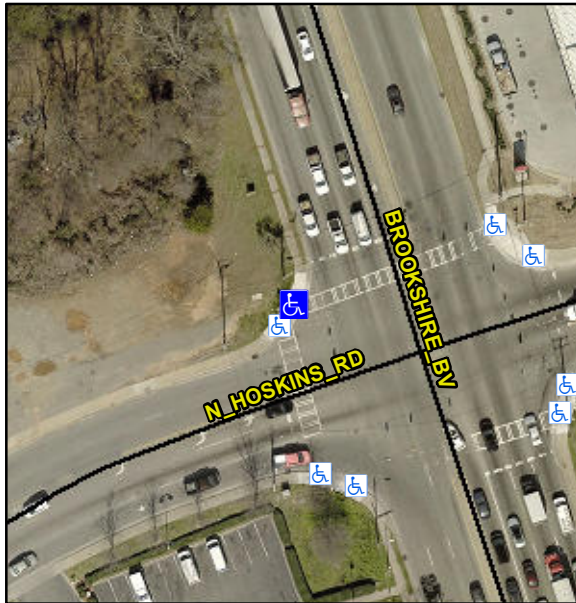

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.3.2, R304.5.3

Street 1 Name	BROOKSHIRE BV
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	64.0	N/A	Ramp Length RT (in)	60.0
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	1.2	No	Ramp Slope RT (%)	17.7
Yes	Ramp XSlope LT (%)	1.4	No	Ramp XSlope RT (%)	3.8
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	75.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	4.7		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.4		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	22.4

