

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 26308	Main Street: WEDDINGTON_RD	Cross Street: MCKEE_RD	Location: NE
ADA ID: 3F169A26BB20	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 2.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

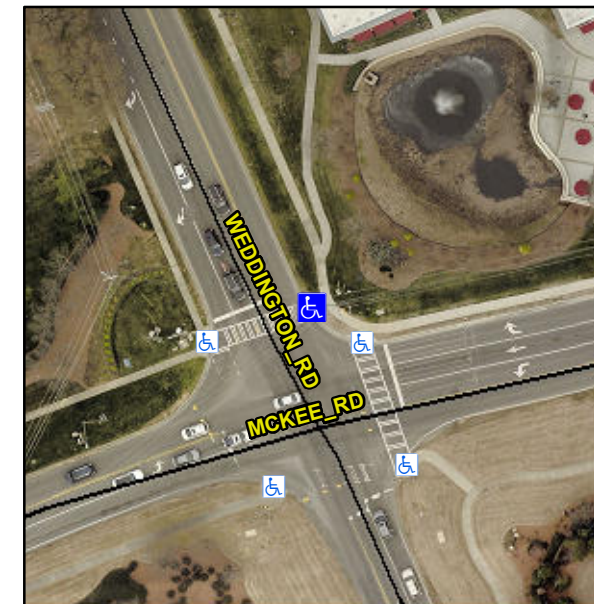

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	87.0	Yes	BlendTrans Slope (%)	2.9
Yes	Ramp Width (in)	61.0	Yes	BlendTrans XSlope (%)	0.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	5.6	N/A	Flare Slope RT (%)	6.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	61.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.9	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.2
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To W		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	107.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.2		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.4		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.4		Clear Space?	Yes
	Road X Slope (%)	3.2	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Yes	Curb Slope (%)	3.7

Street 1 Name	WEDDINGTON RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

