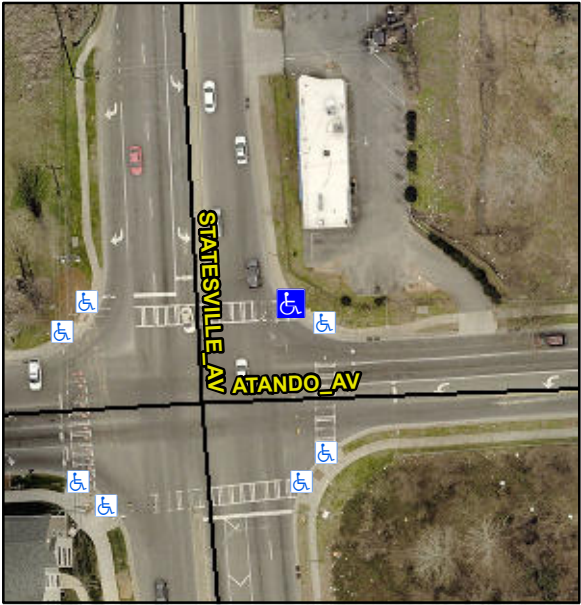



# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 8515	Main Street: ATANDO_AV	Cross Street: STATESVILLE_AV	Location: NE
ADA ID: 3F3D9DC7B6C3	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 18.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length LT (in)	<b>64.0</b>
			<b>No</b>	Ramp Width LT (in)	<b>33.0</b>
			<b>Yes</b>	Ramp Slope LT (%)	<b>5.7</b>
			<b>No</b>	Ramp XSlope LT (%)	<b>3.7</b>
			<b>N/A</b>	Ramp Length (in)	<b>26.0</b>
			<b>No</b>	Ramp Width (in)	<b>45.0</b>
	Surveyor Notes:		<b>N/A</b>	Flare Type LT	<b>N/A</b>
	<b>N/A</b>		<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>
	PROW/ADA:		<b>N/A</b>	Landing Length (in)	<b>N/A</b>
	<b>R304.5.1, R304.5.1, R304.5.3</b>		<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
			<b>N/A</b>	Shared Landing?	<b>N/A</b>
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>Yes</b>
				X Walk 1 Direction	<b>To W</b>
				X Walk 1 Width (in)	<b>118.0</b>
				X Walk 1 Slope (%)	<b>0.2</b>
				X Walk 1 X Slope (%)	<b>2.3</b>
	Total Cost:	<b>\$ 1800.00</b>	<b>N/A</b>	Ramp inside XWalk1?	<b>Yes</b>
				Road Slope (%)	<b>N/A</b>
				Road X Slope (%)	<b>N/A</b>
				Clear Space?	<b>N/A</b>
				Clear Space to XWalk (in)	<b>N/A</b>
				Any Obstruction?	<b>N/A</b>
				Obstruction Type	<b>N/A</b>
				Storm Grate/Utility Hazard?	<b>N/A</b>
				Storm Grate/Utility Type	<b>N/A</b>
					<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>
				Curb Slope (%)	<b>3.4</b>