

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3062	Main Street: LOGANVILLE_DR	Cross Street: PROSPERITY_CHURCH_RD	Location:	E
ADA ID: 3F4FC356F8B9	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

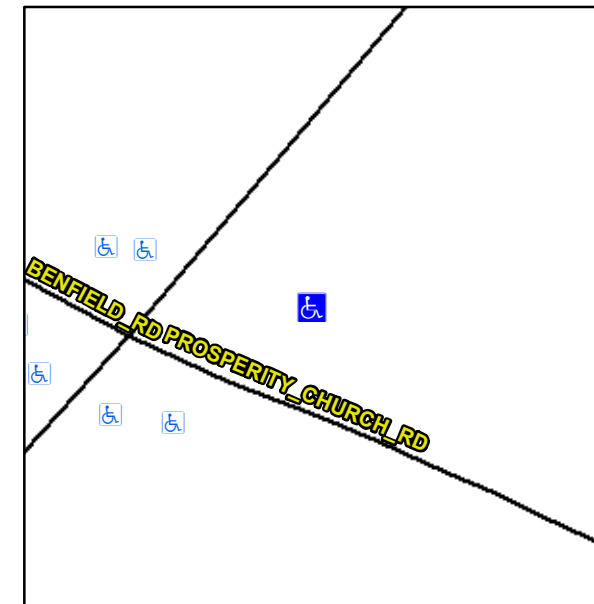

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**VEGETATION OVERGROWTH**

PROW/ADA:

**Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.2, R305.2**

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	138.0	No	Grade Break?	No
Yes	Ramp Width (in)	61.5	N/A	Grade Break Slope (%)	4.5
Yes	Ramp Slope (%)	5.4	N/A	Grade Break XSlope (%)	2.0
Yes	Ramp XSlope (%)	0.3			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	54.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	69.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	4.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.0	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	No	DWS Offset LT (in)	62.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	2.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.1
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	Yes		Road Slope (%)	3.4
	X Walk 1 Direction	To W		Road X Slope (%)	1.2
	X Walk 1 Width (in)	117.5		Clear Space?	Yes
	X Walk 1 Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	1.2	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	14.3

Street 1 Name PROSPERITY CHURCH RD  
 Stop Condition-Street 1 Signal  
 Street 2 Name N/A  
 Stop Condition-Street 2 N/A

