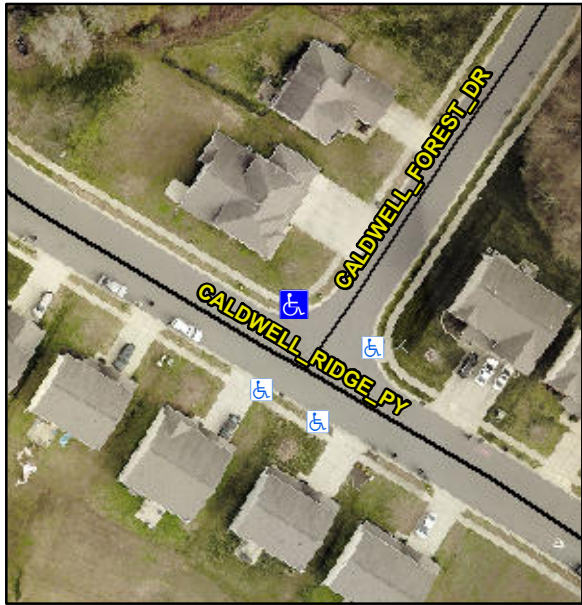


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 42756	Main Street: CALDWELL_FOREST_DR	Cross Street: CALDWELL_RIDGE_PY	Location:	N
ADA ID: 3F6F70BA7860	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 <div>Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1</div>	Possible Solutions:		Compliance			Compliance		
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Description			Description		
			Data			Data		
			N/A			No		
			Yes			No		
			N/A			N/A		
			N/A			N/A		
			N/A			N/A		
			N/A			N/A		
			N/A			N/A		
Surveyor Notes:								
N/A								
PROW/ADA:								
Not Found, R304.2.2, R304.5.3								
Total Cost:		\$ 3200.00						

Compliance			Description			Data			Compliance			Description			Data		
N/A			Ramp Length (in)			57.0			No			Ramp Slope (%)			10.1		
Yes			Ramp Width (in)			50.5			No			Ramp XSlope (%)			4.6		
N/A			Flare Type LT			N/A			N/A			Flare Type RT			N/A		
N/A			Flare Slope LT (%)			N/A			N/A			Flare Slope RT (%)			N/A		
N/A			Flare Traversable LT?			N/A			N/A			Flare Traversable RT?			N/A		
N/A			Landing Length (in)			N/A			N/A			DWS Provided?			N/A		
N/A			Landing Width (in)			N/A			N/A			DWS Contrast?			N/A		
N/A			Landing Slope (%)			N/A			N/A			DWS Length (in)			N/A		
N/A			Landing X Slope (%)			N/A			N/A			DWS Full Width?			N/A		
N/A			Landing Curb? (Y/N)			N/A			N/A			DWS Offset (in)			N/A		
N/A			Shared Landing?			N/A											
N/A			Gutter Ponding?			N/A			N/A			Gutter Slope (%)			N/A		
N/A			Gutter Lip Ht (in)			N/A			N/A			Gutter X Slope (%)			N/A		
N/A			Painted X Walk1?			No			N/A			Painted X Walk2?			No		
			X Walk 1 Direction			To SW						X Walk 2 Direction			To SE		
N/A			X Walk 1 Width (in)			N/A			N/A			X Walk 2 Width (in)			N/A		
			X Walk 1 Slope (%)			3.8						X Walk 2 Slope (%)			7.2		
			X Walk 1 X Slope (%)			6.4						X Walk 2 X Slope (%)			0.3		
N/A			Ramp inside XWalk1?			N/A			N/A			Ramp inside XWalk2?			N/A		
			Road Slope (%)			3.6			N/A			Clear Space?			N/A		
			Road X Slope (%)			6.0			N/A			Clear Space to XWalk (in)			N/A		
N/A			Any Obstructions?			N/A			N/A			Storm Grate/Utility Hazard?			N/A		
			Obstruction Type									Storm Grate/Utility Type					
									N/A						N/A		
									Yes			Surface Condition? (G/P)			Good		

Total Cost: \$ 3200.00

