

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 9962	Main Street: LITTLE ROCK RD	Cross Street: N/A	Location:	E
ADA ID: 3F890AE4521E	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 17.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

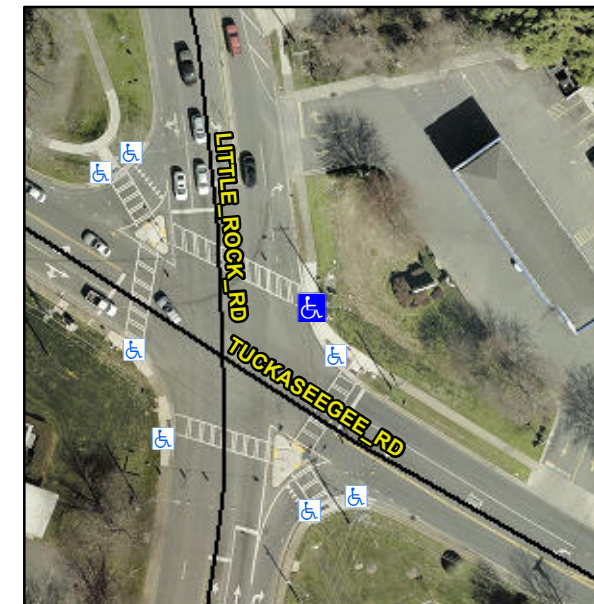

Possible Solutions:

Remove & Replace Entire Ramp.
Remove & Replace Gutter.

Surveyor Notes:

CURB LIP 1.5, LT RP < 5%, RT RP < 5%

PROW/ADA:

R304.2.1, R304.5.3, R305, R302.7.2

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	49.5	N/A	Ramp Length RT (in)	59.0
Yes	Ramp Width LT (in)	62.0	Yes	Ramp Width RT (in)	62.0
Yes	Ramp Slope LT (%)	0.2	Yes	Ramp Slope RT (%)	0.9
Yes	Ramp XSlope LT (%)	0.5	Yes	Ramp XSlope RT (%)	0.1
Yes	Landing Length (in)	62.0	No	DWS Provided?	No
No	Landing Width (in)	44.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.9	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.3	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.3
No	Gutter Lip Ht (in)	0.5	No	Gutter X Slope (%)	2.6
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.0		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Compliant	Curb Slope (%)	4.0

