


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 10772 Main Street: E_36TH_ST Cross Street: THE_PLAZA Location: S

ADA ID: 3F98A1BC4DDD Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

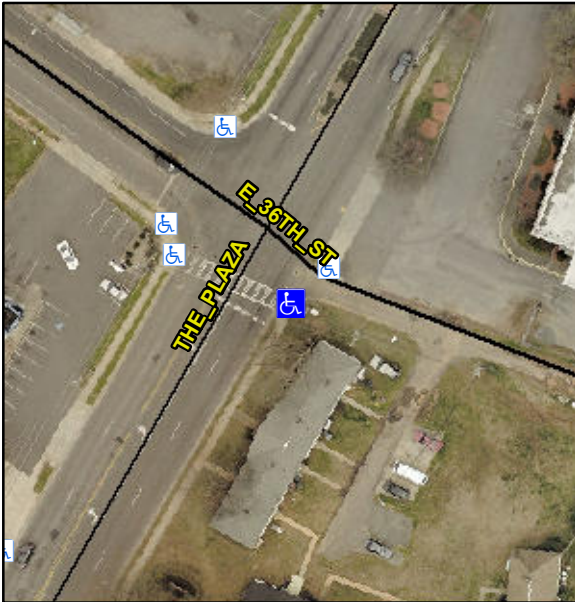

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	59.5	No	Ramp Slope (%)	8.8
Yes	Ramp Width (in)	58.0	No	Ramp XSlope (%)	3.1
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	95.5
	X Walk 1 Slope (%)	2.0		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	0.8		X Walk 2 X Slope (%)	3.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.4	N/A	Clear Space?	N/A
	Road X Slope (%)	3.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
Yes	Surface Condition? (G/P)				Good

Street 1 Name **E 36TH ST**
 Stop Condition-Street 2 **StopSign**
 Street 2 Name **THE PLAZA**
 Stop Condition-Street 1 **Signal**

