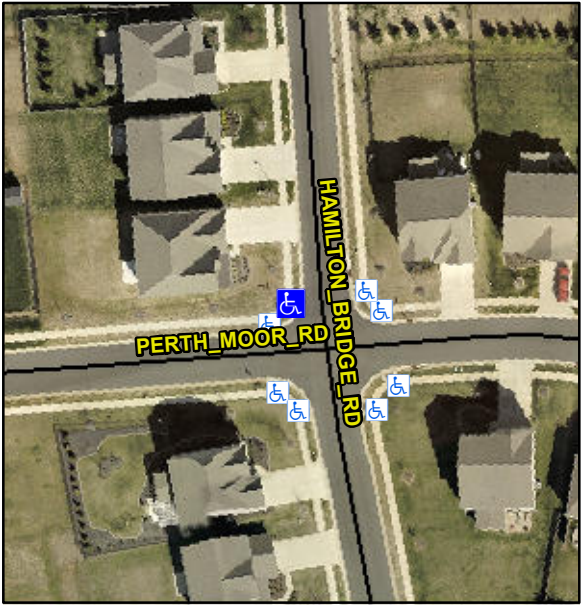


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 53893	Main Street: PERTH_MOOR_RD	Cross Street: HAMILTON_BRIDGE_RD	Location: NW
ADA ID: 403017F92A9E	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 8.75			

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:						
	N/A						
	PROW/ADA:						
	R304.5.1						
	Street 1 Name	HAMILTON BRIDGE RD					
	Stop Condition-Street 2	None					
	Street 2 Name	N/A					
	Stop Condition-Street 1	N/A					
Total Cost:		\$ 1850.00					
				Compliance	Description	Data	Compliance
				Description			Description
				Data			Data
				N/A	Ramp Length (in)	45.5	Yes
				No	Ramp Width (in)	47.0	Yes
				N/A	Flare Type LT	N/A	N/A
				N/A	Flare Slope LT (%)	N/A	N/A
				N/A	Flare Traversable LT?	N/A	N/A
				N/A	Flare Slope RT (%)	N/A	N/A
				N/A	Flare Traversable RT?	N/A	N/A
				N/A	Landing Length (in)	N/A	N/A
				N/A	Landing Width (in)	N/A	N/A
				N/A	Landing Slope (%)	N/A	N/A
				N/A	Landing X Slope (%)	N/A	N/A
				N/A	Landing Curb? (Y/N)	N/A	N/A
				N/A	Shared Landing?	N/A	N/A
				N/A	Gutter Ponding?	N/A	N/A
				N/A	Gutter Lip Ht (in)	2.0	N/A
				N/A	Painted X Walk1?	No	N/A
					X Walk 1 Direction	To E	
				N/A	X Walk 1 Width (in)	N/A	N/A
					X Walk 1 Slope (%)	6.2	
					X Walk 1 X Slope (%)	1.0	
				N/A	Ramp inside XWalk1?	N/A	N/A
					Road Slope (%)	N/A	
					Road X Slope (%)	N/A	
				N/A	Any Obstructions?	N/A	N/A
					Obstruction Type		
						N/A	N/A
				Yes	Surface Condition? (G/P)		Good

