

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: CALDWELL_RD	Cross Street: OLD_STONE_CROSSING_DR	Location: SW
ADA ID: 4034899042EE	Ramp Type: Combination1Diag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

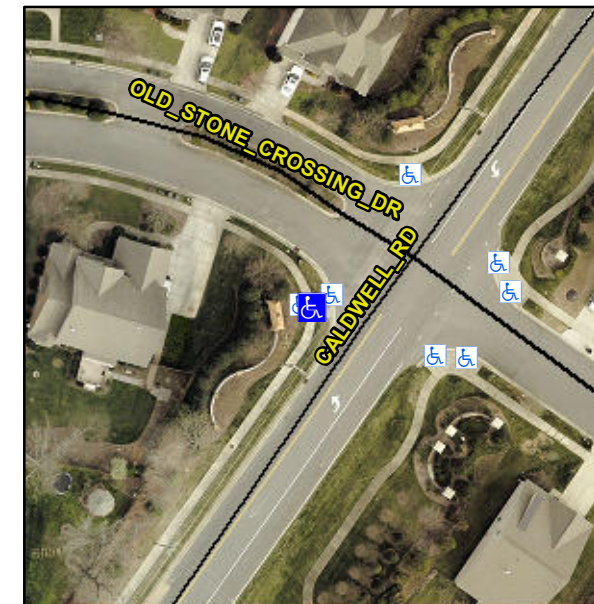

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3, R304.3.2**

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	40.0	N/A	Ramp Length RT (in)	26.5
Yes	Ramp Width LT (in)	58.0	Yes	Ramp Width RT (in)	62.0
Yes	Ramp Slope LT (%)	6.8	No	Ramp Slope RT (%)	8.6
No	Ramp XSlope LT (%)	3.8	Yes	Ramp XSlope RT (%)	1.7
N/A	Ramp Length (in)	92.0	Yes	Ramp Slope (%)	5.0
No	Ramp Width (in)	46.0	No	Ramp XSlope (%)	6.6
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	7.3		X Walk 2 Slope (%)	3.8
	X Walk 1 X Slope (%)	1.0		X Walk 2 X Slope (%)	11.0
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.5		Clear Space?	N/A
	Road X Slope (%)	9.3	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	14.2

Street 1 Name None  
 Stop Condition-Street 1 CALDWELL RD  
 Street 2 Name StopSign  
 Stop Condition-Street 2 OLD STONE CROSSING DR

