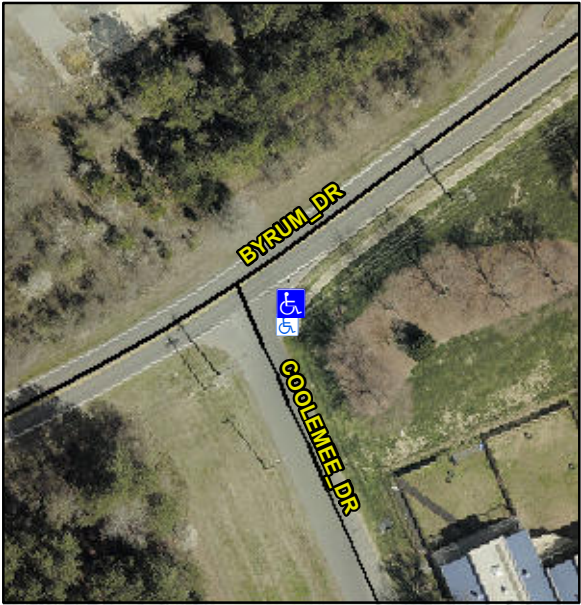


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: BYRUM_DR	Cross Street: COOLEMEE_DR	Location: SE
ADA ID: 4084C4F10B04	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length (in)	64.0	<b>Yes</b>
			Yes	Ramp Width (in)	48.0	<b>No</b>
			N/A	Flare Type LT	N/A	<b>N/A</b>
			N/A	Flare Slope LT (%)	N/A	<b>N/A</b>
			N/A	Flare Traversable LT?	N/A	<b>N/A</b>
			N/A	Landing Length (in)	N/A	<b>N/A</b>
			N/A	Landing Width (in)	N/A	<b>N/A</b>
			N/A	Landing Slope (%)	N/A	<b>N/A</b>
			N/A	Landing X Slope (%)	N/A	<b>N/A</b>
			N/A	Landing Curb? (Y/N)	N/A	<b>N/A</b>
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	<b>N/A</b>
			N/A	Gutter Lip Ht (in)	N/A	<b>N/A</b>
			N/A	Painted X Walk1?	No	<b>N/A</b>
				X Walk 1 Direction	To N	
			N/A	X Walk 1 Width (in)	N/A	<b>N/A</b>
				X Walk 1 Slope (%)	1.5	
				X Walk 1 X Slope (%)	1.2	
			N/A	Ramp inside XWalk1?	N/A	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>Not Found, R304.5.3</b></p>				Ramp Slope (%)	6.5	
				Ramp XSlope (%)	5.2	
				Flare Type RT	N/A	
				Flare Slope RT (%)	N/A	
				Flare Traversable RT?	N/A	
				DWS Provided?	N/A	
				DWS Contrast?	N/A	
				DWS Length (in)	N/A	
				DWS Full Width?	N/A	
				DWS Offset (in)	N/A	
				Gutter Slope (%)	N/A	
				Gutter X Slope (%)	N/A	
				Painted X Walk2?	N/A	
				X Walk 2 Direction	N/A	
				X Walk 2 Width (in)	N/A	
				X Walk 2 Slope (%)	N/A	
				X Walk 2 X Slope (%)	N/A	
				Ramp inside XWalk2?	N/A	
				Clear Space?	N/A	
				Clear Space to XWalk (in)	N/A	
<p>Total Cost:</p> <p>\$ 1850.00</p>				Storm Grate/Utility Hazard?	N/A	
				Storm Grate/Utility Type	N/A	
					N/A	
				Surface Condition? (G/P)	Good	

