

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 27806	Main Street: PARKS_FARM_LN	Cross Street: REA_RD	Location: NW
ADA ID: 40AA352BEA67	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

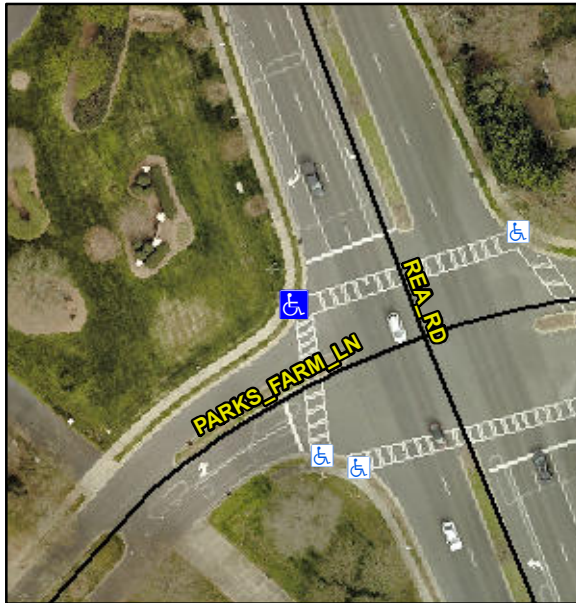

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found, R304.2.1, R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	96.0	Yes	Ramp Slope (%)	6.5
Yes	Ramp Width (in)	51.0	Yes	Ramp XSlope (%)	2.3
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.6	Yes	Flare Slope RT (%)	9.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	11.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	51.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.9	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	3.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To S		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	102.0	N/A	X Walk 2 Width (in)	108.0
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	2.1
	X Walk 1 X Slope (%)	2.5		X Walk 2 X Slope (%)	1.1
Yes	Ramp inside XWalk1?	Yes	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.5	N/A	Clear Space?	Yes
	Road X Slope (%)	1.3	Yes	Clear Space to XWalk (in)	102.0
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3200.00

