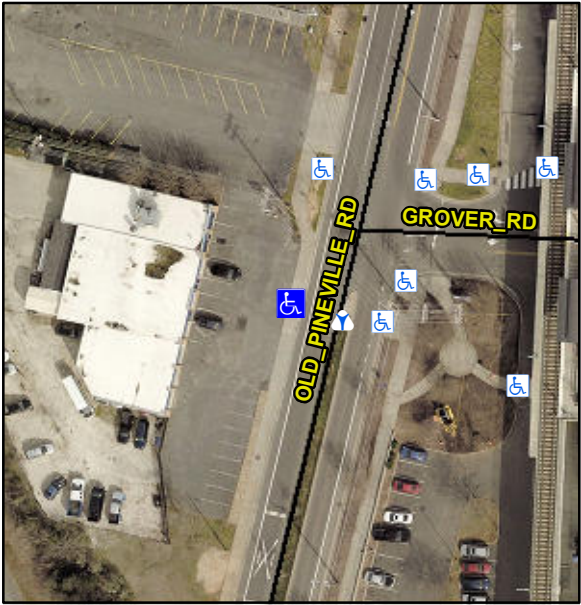


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18958	Main Street: GROVER_RD	Cross Street: OLD_PINEVILLE_RD	Location: SW
ADA ID: 4162C5473EE0	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Entire Ramp.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.2.2-Perp, R304.3.2-Para, R305.2				
Street 1 Name	OLD PINEVILLE RD				
Stop Condition-Street 1	None				
Street 2 Name	N/A				
Stop Condition-Street 2	N/A				
Total Cost:		\$	1600.00		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	70.5	N/A	Ramp Length RT (in)	73.0
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	72.0
Yes	Ramp Slope LT (%)	7.5	Yes	Ramp Slope RT (%)	5.6
Yes	Ramp XSlope LT (%)	0.7	Yes	Ramp XSlope RT (%)	1.1
Yes	Landing Length (in)	72.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.1	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.4	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Replace	Curb Slope (%)	17.4

