


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 28401	Main Street: WADE_ARDREY_RD	Cross Street: MARVIN_RD	Location: SE
ADA ID: 416427348D40	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0			

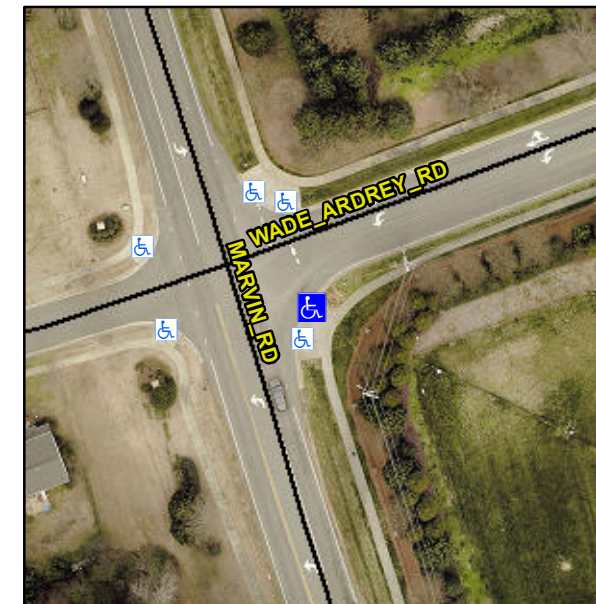

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

CURB GAP 1.0

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	136.0	Yes	BlendTrans Slope (%)	3.3
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	7.7	Yes	Flare Slope RT (%)	4.6
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.6	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	2.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	0.3		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.3		Clear Space?	Yes
	Road X Slope (%)	0.1	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	13.5

