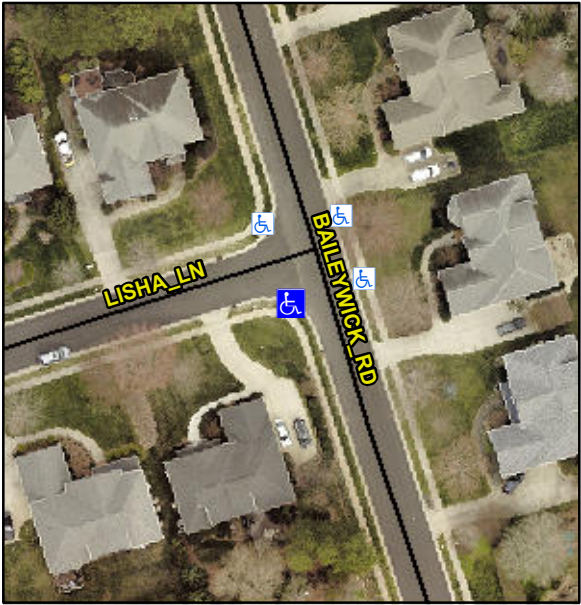


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 32296	Main Street: BAILEYWICK_RD	Cross Street: LISHA_LN	Location: SW
ADA ID: 41659E0B58C5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.5.3, R304.2.1, R305				
	Street 1 Name	BAILEYWICK RD			
	Stop Condition-Street 2	None			
	Street 2 Name	LISHA LN			
	Stop Condition-Street 1	StopSign			
	Total Cost:	\$ 3200.00			
Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.4
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	7.7	Yes	Flare Slope RT (%)	4.2
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	30.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
Yes	Landing Slope (%)	1.2	N/A	DWS Length (in)	N/A
No	Landing X Slope (%)	3.0	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.4
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To N
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	1.1
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	3.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.6	N/A	Clear Space?	Yes
	Road X Slope (%)	2.0	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

