


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 51615		Main Street: BENFIELD_RD		Cross Street: PROSPERITY_CHURCH_RD		Location: SW											
ADA ID: 41A42AC769A6		Ramp Type: Directional1		Initial Pass/Fail: Pass		Overall Compliance: No		Severity Score: 0.25									
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance													
<div></div> <div>Possible Solutions: Remove & Replace Entire Ramp. Remove & Replace Gutter.</div> <div>Surveyor Notes: N/A</div> <div>PROW/ADA: R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.2, R305.2</div> <div>Street 1 Name BENFIELD RD</div> <div>Stop Condition-Street 1 Signal</div> <div>Street 2 Name N/A</div> <div>Stop Condition-Street 2 N/A</div> <div>Total Cost: \$ 2350.00</div>				Compliance		Description		Data		Compliance		Description		Data			
				N/A		Ramp Length (in)		93.0		No		Grade Break?		No			
				Yes		Ramp Width (in)		71.0		N/A		Grade Break Slope (%)		N/A			
				Yes		Ramp Slope (%)		6.7		N/A		Grade Break XSlope (%)		N/A			
				Yes		Ramp XSlope (%)		5.0									
				Yes		Flare Type LT		N/A		Yes		Flare Type RT		N/A			
				N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		N/A			
				N/A		Flare Traversable LT?		No		N/A		Flare Traversable RT?		No			
				Yes		Landing Length (in)		72.0		Yes		DWS Provided?		Yes			
				Yes		Landing Width (in)		72.0		Yes		DWS Contrast?		Yes			
				No		Landing Slope (%)		3.0		Yes		DWS Length (in)		24.0			
				No		Landing X Slope (%)		7.0		Yes		DWS Full Width?		Yes			
				N/A		Landing Curb? (Y/N)		N/A		No		DWS Offset LT (in)		3.0			
				N/A		Shared Landing?		No		Yes		DWS Offset RT (in)		10.0			
				Yes		Gutter Ponding?		No		Yes		Gutter Slope (%)		3.2			
				Yes		Gutter Lip Ht (in)		0.0		No		Gutter X Slope (%)		6.2			
				N/A		Painted X Walk1?		Yes				Road Slope (%)		0.6			
						X Walk 1 Direction		To N				Road X Slope (%)		5.1			
						X Walk 1 Width (in)		111.0				Clear Space?		Yes			
						X Walk 1 Slope (%)		0.6		N/A		Clear Space to XWalk (in)		N/A			
						X Walk 1 X Slope (%)		5.1		Yes		Storm Grate/Utility Hazard?		No			
				Yes		Ramp inside XWalk1?		Yes				Storm Grate/Utility Type					
				Yes		Any Obstructions?		No						N/A			
						Obstruction Type				Yes		Surface Condition? (G/P)		Good			
										N/A		N/A		Curb Slope (%)		N/A	

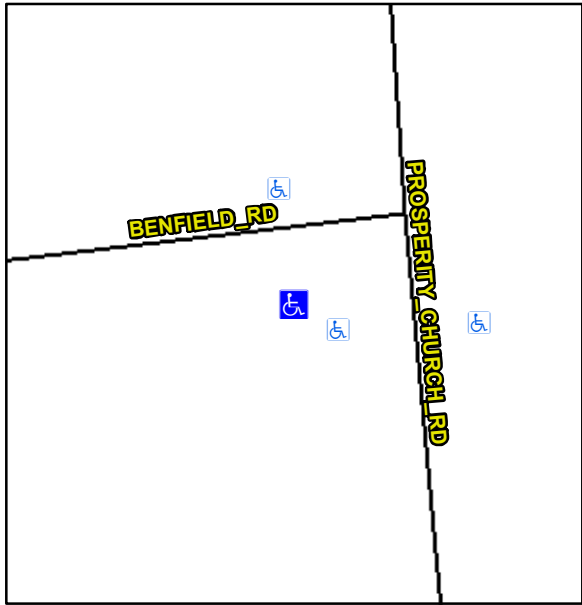