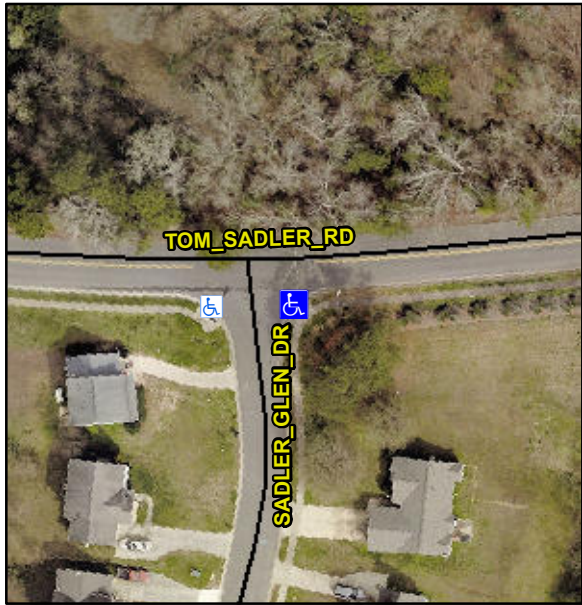


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 29323	Main Street: SADLER_GLEN_DR	Cross Street: TOM_SADLER_RD	Location: E
ADA ID: 41CC35EF37A7	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 46.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance													
	Possible Solutions:		Compliance			Description			Data	Compliance			Description			Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)			47.0			No	Ramp Slope (%)			8.4		
			No	Ramp Width (in)			45.5			No	Ramp XSlope (%)			7.3		
			N/A	Flare Type LT			N/A			N/A	Flare Type RT			N/A		
			N/A	Flare Slope LT (%)			N/A			N/A	Flare Slope RT (%)			N/A		
			N/A	Flare Traversable LT?			N/A			N/A	Flare Traversable RT?			N/A		
			N/A	Landing Length (in)			N/A			N/A	DWS Provided?			N/A		
			N/A	Landing Width (in)			N/A			N/A	DWS Contrast?			N/A		
			N/A	Landing Slope (%)			N/A			N/A	DWS Length (in)			N/A		
			N/A	Landing X Slope (%)			N/A			N/A	DWS Full Width?			N/A		
Surveyor Notes:		N/A	N/A			N/A			N/A	DWS Offset (in)			N/A			
PROW/ADA:		Not Found, R304.5.1, R304.2.2, R304.5.3	N/A			N/A			N/A	Gutter Ponding?			N/A			
			N/A			N/A			N/A	Gutter Lip Ht (in)			N/A			
			N/A			No			N/A	Painted X Walk2?			N/A			
			X Walk 1 Direction			To W				X Walk 2 Direction			N/A			
			N/A			N/A			N/A	X Walk 2 Width (in)			N/A			
			X Walk 1 Slope (%)			3.2				X Walk 2 Slope (%)			N/A			
			X Walk 1 X Slope (%)			5.0				X Walk 2 X Slope (%)			N/A			
			N/A			N/A			N/A	Ramp inside XWalk2?			N/A			
			Road Slope (%)			N/A			N/A	Clear Space?			N/A			
			Road X Slope (%)			N/A			N/A	Clear Space to XWalk (in)			N/A			
			N/A			N/A			N/A	Storm Grate/Utility Hazard?			N/A			
			Obstruction Type							Storm Grate/Utility Type						
									N/A				N/A			
									Yes	Surface Condition? (G/P)			Good			

Street 1 Name	SADLER GLEN DR
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 1850.00

