

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48432	Main Street: WHITHORN_WY	Cross Street: SEAMILL_RD	Location: NW
ADA ID: 421B19D2D848	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 0.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

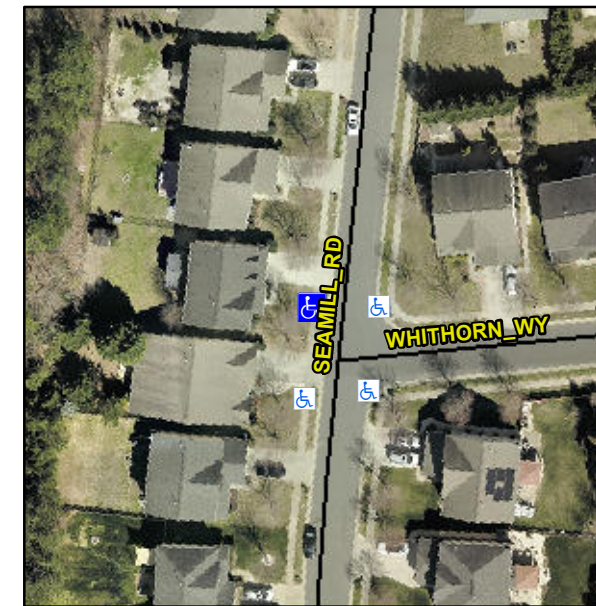

Possible Solutions:

Remove & Replace Landing.

Surveyor Notes:

N/A

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para,
R304.5.3**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	47.0	Yes	Ramp Slope (%)	7.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	3.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	0.9	N/A	Flare Slope RT (%)	8.0
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.0	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.5
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	3.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To E		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.0		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 500.00

Street 1 Name SEAMILL RD
 Stop Condition-Street 2 None
 Street 2 Name N/A
 Stop Condition-Street 1 N/A

