

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10015273	Main Street: E_12TH_ST	Cross Street: N/A	Location: W
ADA ID: 42454068554A	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

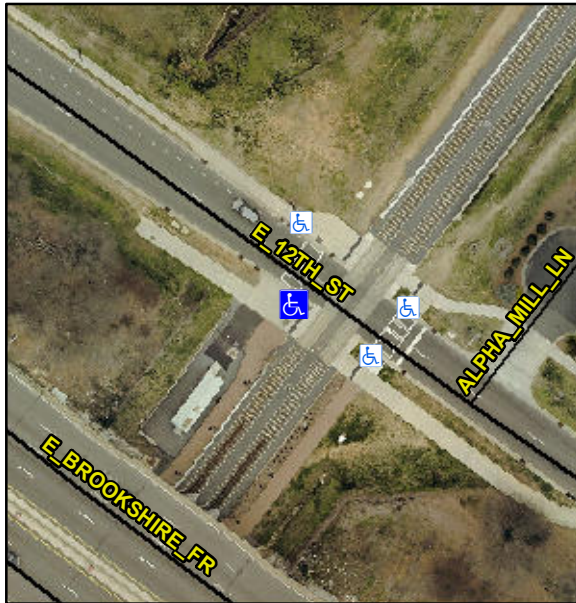

Possible Solutions:

**Remove & Replace Entire Ramp.  
Utility Present.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R302.3, R402.2**

Street 1 Name	E 12TH ST
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	N/A

Total Cost: \$ 6850.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	95.0	Yes	Ramp Slope (%)	7.8
Yes	Ramp Width (in)	62.5	No	Ramp XSlope (%)	3.9
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.4	Yes	Flare Slope RT (%)	1.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	102.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	2.1
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.3		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	2.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	Yes
	Obstruction Type			Storm Grate/Utility Type	
		N/A		<b>STORM GRATE</b>	
		Yes		Surface Condition? (G/P)	Good

