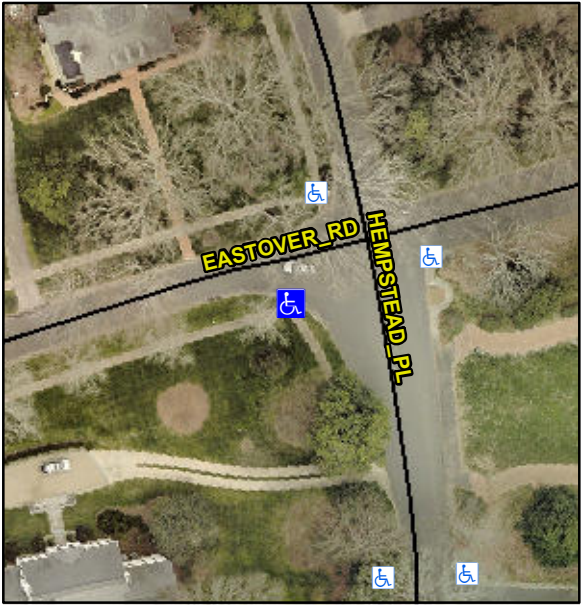


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15639	Main Street: EASTOVER_RD	Cross Street: HEMPSTEAD_PL	Location: SW
ADA ID: 424E5EE21B0B	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 10.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para				
Street 1 Name	HEMPSTEAD PL				
Stop Condition-Street 2	None				
Street 2 Name	EASTOVER RD				
Stop Condition-Street 1	StopSign				
Total Cost:		\$	3950.00		

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	80.0	Yes	Ramp Slope (%)	5.8
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.1	Yes	Flare Slope RT (%)	9.0
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	25.5
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	2.0
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.9
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To E		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.5		X Walk 2 Slope (%)	2.0
	X Walk 1 X Slope (%)	3.5		X Walk 2 X Slope (%)	0.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	3.3	N/A	Clear Space?	Yes
	Road X Slope (%)	3.7	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

