


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5408	Main Street: CARVER_PL	Cross Street: ROCKWELL_BV	Location: W
ADA ID: 424E6814F4B8	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 43.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

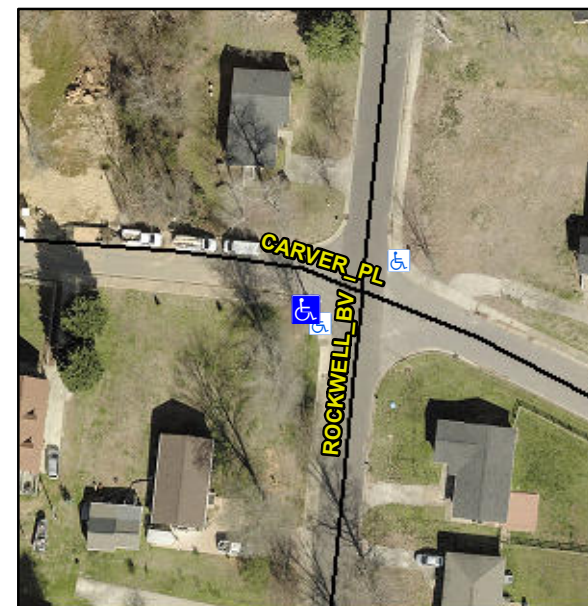

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

POWER POLE OBS

PROW/ADA:

R304.5.1, R304.3.2, R304.5.3

Street 1 Name	CARVER BV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	32.0	N/A	Ramp Length RT (in)	56.0
No	Ramp Width LT (in)	41.0	No	Ramp Width RT (in)	35.0
No	Ramp Slope LT (%)	14.3	Yes	Ramp Slope RT (%)	6.5
Yes	Ramp XSlope LT (%)	1.2	No	Ramp XSlope RT (%)	2.6
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	15.1

