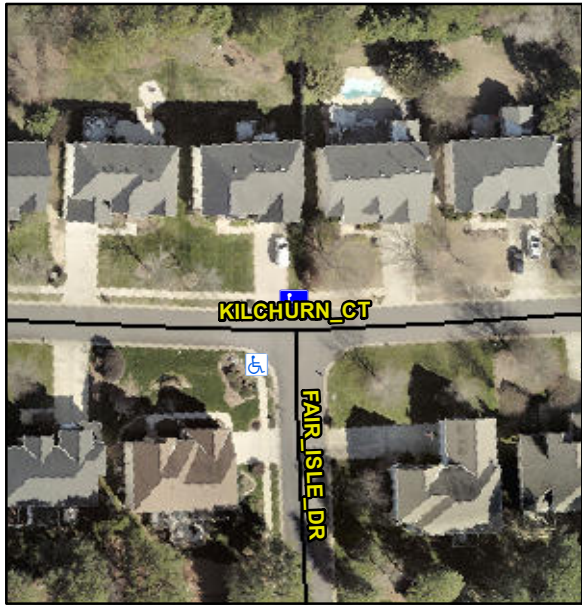


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 27895	Main Street: FAIR_ISLE_DR	Cross Street: KILCHURN_CT	Location:	N
ADA ID: 42896DE8C3E3	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	50.0	No	Ramp Slope (%)	11.6		
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.9		
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A		
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A		
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A		
Surveyor Notes:		N/A	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A		
PROW/ADA:		Not Found, R304.2.2, R304.5.3	N/A	Shared Landing?	N/A					
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A		
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A		
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A		
				X Walk 1 Direction	To SW		X Walk 2 Direction	N/A		
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A		
				X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	N/A		
				X Walk 1 X Slope (%)	4.4		X Walk 2 X Slope (%)	N/A		
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A		
				Road Slope (%)	N/A	N/A	Clear Space?	N/A		
				Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A		
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A		
				Obstruction Type			Storm Grate/Utility Type			
					N/A			N/A		
						Yes	Surface Condition? (G/P)	Good		
Street 1 Name		KILCHURN CT								
Stop Condition-Street 2		None								
Street 2 Name		N/A								
Stop Condition-Street 1		N/A								
Total Cost:		\$ 1850.00								

