


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: E_4TH_ST	Cross Street: S_CALDWELL_ST	Location: W
ADA ID: 42AF0BA8D0E8	Ramp Type: Directional2	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

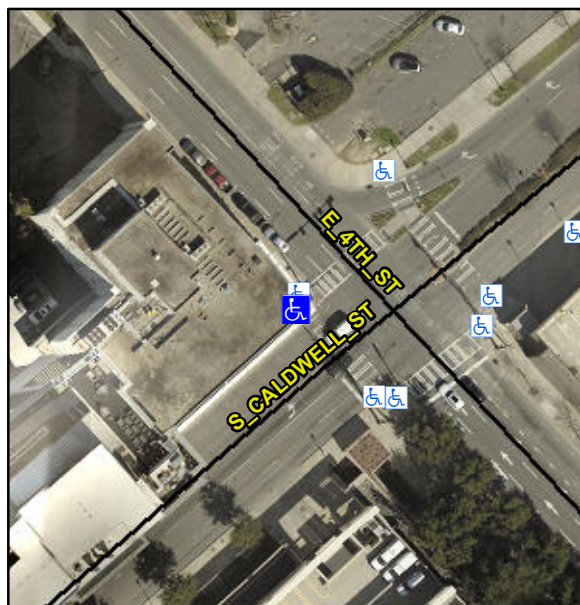

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	62.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	48.0	No	Grade Break Slope (%)	10.4
Yes	Ramp Slope (%)	4.6	Yes	Grade Break XSlope (%)	0.4
Yes	Ramp XSlope (%)	1.9			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
Yes	Flare Slope LT (%)	8.6	N/A	Flare Slope RT (%)	11.5
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	67.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	6.9	Yes	DWS Length (in)	37.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	13.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	4.4
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	3.4
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.2
	X Walk 1 Direction	To SE		Road X Slope (%)	2.4
	X Walk 1 Width (in)	120.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.4	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	13.1

Total Cost: \$ 2550.00

