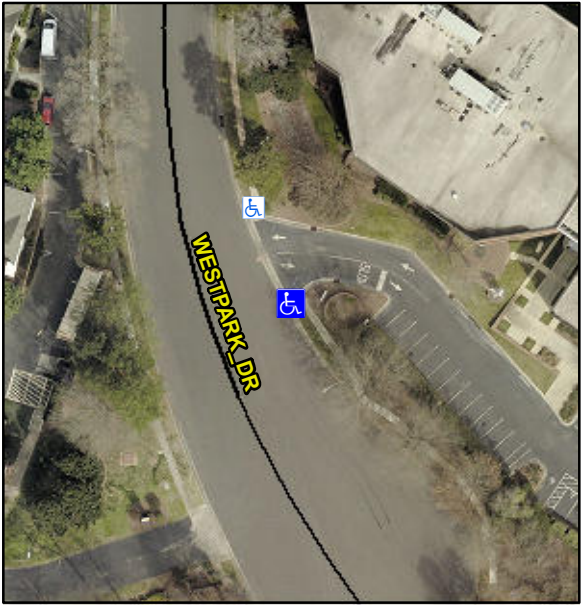


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10041482	Main Street: WESTPARK_DR	Cross Street: N/A	Location: SE
ADA ID: 42BCB1AC921C	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 33.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes: N/A	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	50.0	N/A	Grade Break?	N/A
		No	Ramp Width (in)	47.5	N/A	Grade Break Slope (%)	0.0
		Yes	Ramp Slope (%)	5.1	N/A	Grade Break XSlope (%)	0.0
		No	Ramp XSlope (%)	12.7			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	PROW/ADA: R304.5.1, R304.5.3	N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	0.4
			X Walk 1 Direction	To N		Road X Slope (%)	10.1
Street 1 Name	ENTRANCE		X Walk 1 Width (in)	N/A		Clear Space?	N/A
Stop Condition-Street 1	StopSign		X Walk 1 Slope (%)	0.4	N/A	Clear Space to XWalk (in)	N/A
Street 2 Name	N/A		X Walk 1 X Slope (%)	10.1	N/A	Storm Grate/Utility Hazard?	N/A
Stop Condition-Street 2	N/A		N/A	Ramp inside XWalk1?	N/A	Storm Grate/Utility Type	N/A
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	9.9
Total Cost:		\$	1600.00				

