


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 17310		Main Street: QUEENS_RD_WEST		Cross Street: SELWYN_AV		Location: SE													
ADA ID: 42F6AD44227E		Ramp Type: Directional1		Initial Pass/Fail: Fail		Overall Compliance: No		Severity Score: 25											
Codes/Mitigation Info/Possible Solution				Field Measurements/Component Compliance															
 Street 1 NameSELWYN AV Stop Condition-Street 1Signal Street 2 NameN/A Stop Condition-Street 2N/A				Possible Solutions:		Compliance		Description		Data		Compliance		Description		Data			
				Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		99.0		N/A		Grade Break?		N/A		N/A	
						Yes		Ramp Width (in)		70.0		N/A		Grade Break Slope (%)		0.0		0.0	
						No		Ramp Slope (%)		9.0		N/A		Grade Break XSlope (%)		0.0		0.0	
						No		Ramp XSlope (%)		5.1									
						N/A		Flare Type LT		N/A		N/A		Flare Type RT		N/A		N/A	
						N/A		Flare Slope LT (%)		N/A		N/A		Flare Slope RT (%)		0.0		0.0	
						N/A		Flare Traversable LT?		N/A		N/A		Flare Traversable RT?		N/A		N/A	
						N/A		Landing Length (in)		0.0		N/A		DWS Provided?		N/A		N/A	
						N/A		Landing Width (in)		0.0		N/A		DWS Contrast?		N/A		N/A	
		N/A		Landing Slope (%)		0.0		N/A		DWS Length (in)		N/A		N/A					
		N/A		Landing X Slope (%)		0.0		N/A		DWS Full Width?		N/A		N/A					
		N/A		Landing Curb? (Y/N)		N/A		N/A		DWS Offset LT (in)		N/A		N/A					
		N/A		Shared Landing?		N/A		N/A		DWS Offset RT (in)		N/A		N/A					
		N/A		Gutter Ponding?		0.0		N/A		Gutter Slope (%)		N/A		N/A					
		N/A		Gutter Lip Ht (in)		0.0		N/A		Gutter X Slope (%)		N/A		N/A					
		N/A		Painted X Walk1?		Yes				Road Slope (%)		6.1		6.1					
				X Walk 1 Direction		To W				Road X Slope (%)		0.0		0.0					
				X Walk 1 Width (in)		111.0				Clear Space?		N/A		N/A					
				X Walk 1 Slope (%)		6.1		N/A		Clear Space to XWalk (in)		N/A		N/A					
				X Walk 1 X Slope (%)		0.0		N/A		Storm Grate/Utility Hazard?		N/A		N/A					
		N/A		Ramp inside XWalk1?		Yes				Storm Grate/Utility Type									
		N/A		Any Obstructions?		N/A						N/A		N/A					
				Obstruction Type				Yes		Surface Condition? (G/P)		Good		Good					
								N/A		N/A		Curb Slope (%)		28.5					
		Total Cost:		\$		1600.00													

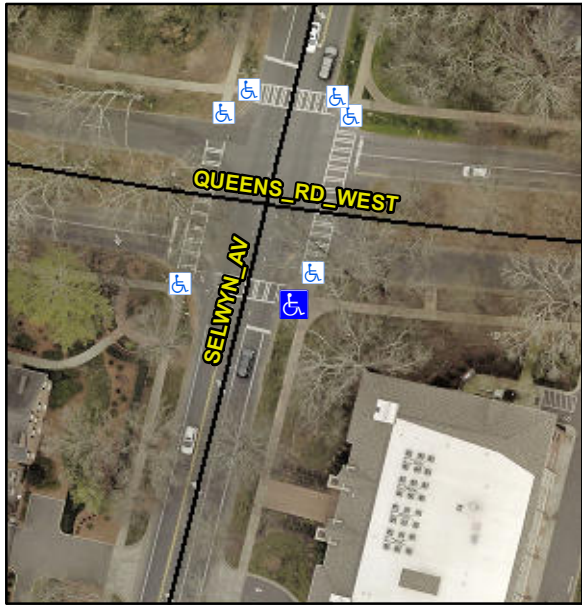