


| | | | | |
|------------------------|-------------------------|----------------------------|-------------------------|-------------------|
| Intersection ID: 11318 | Main Street: GRANDIN_RD | Cross Street: W_4TH_ST_EXT | Location: | NE |
| ADA ID: 43881B150982 | Ramp Type: Perp | Initial Pass/Fail: Pass | Overall Compliance: Yes | Severity Score: 0 |

| Codes/Mitigation Info/Possible Solution | | | Field Measurements/Component Compliance | | | | | |
|--|---------------------|--|---|-----------------------|-------|-------------|-----------------------------|------|
|  | Possible Solutions: | | Compliance | | | Compliance | | |
| | N/A | | Description | | | Description | | |
| | | | Data | | | Data | | |
| | | | N/A | Ramp Length (in) | 48.0 | Yes | Ramp Slope (%) | 7.6 |
| | | | Yes | Ramp Width (in) | 70.0 | Yes | Ramp XSlope (%) | 1.6 |
| | | | Yes | Flare Type LT | Curb | Yes | Flare Type RT | N/A |
| | | | Yes | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| | | | N/A | Flare Traversable LT? | No | N/A | Flare Traversable RT? | No |
| | | | Yes | Landing Length (in) | 71.0 | Yes | DWS Provided? | Yes |
| | | | Yes | Landing Width (in) | 70.0 | Yes | DWS Contrast? | Yes |
| Surveyor Notes: | N/A | | Yes | Landing Slope (%) | 0.5 | Yes | DWS Length (in) | 24.0 |
| | | | Yes | Landing X Slope (%) | 1.5 | Yes | DWS Full Width? | Yes |
| | | | N/A | Landing Curb? (Y/N) | No | Yes | DWS Offset (in) | 0.0 |
| | | | N/A | Shared Landing? | No | | | |
| | | | Yes | Gutter Ponding? | No | Yes | Gutter Slope (%) | 1.4 |
| | | | Yes | Gutter Lip Ht (in) | 0.0 | Yes | Gutter X Slope (%) | 2.4 |
| | | | N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A |
| | | | | X Walk 1 Direction | To SW | | X Walk 2 Direction | N/A |
| | | | N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | | | | X Walk 1 Slope (%) | 0.8 | | X Walk 2 Slope (%) | N/A |
| PROW/ADA: | | | | X Walk 1 X Slope (%) | 3.0 | | X Walk 2 X Slope (%) | N/A |
| | | | N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | | | | Road Slope (%) | N/A | N/A | Clear Space? | Yes |
| | | | | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| | | | Yes | Any Obstructions? | No | Yes | Storm Grate/Utility Hazard? | No |
| | | | | Obstruction Type | | | Storm Grate/Utility Type | |
| | | | | | N/A | | | N/A |
| | | | | | | Yes | Surface Condition? (G/P) | Good |
| | Total Cost: | | \$ | 0.00 | | | | |

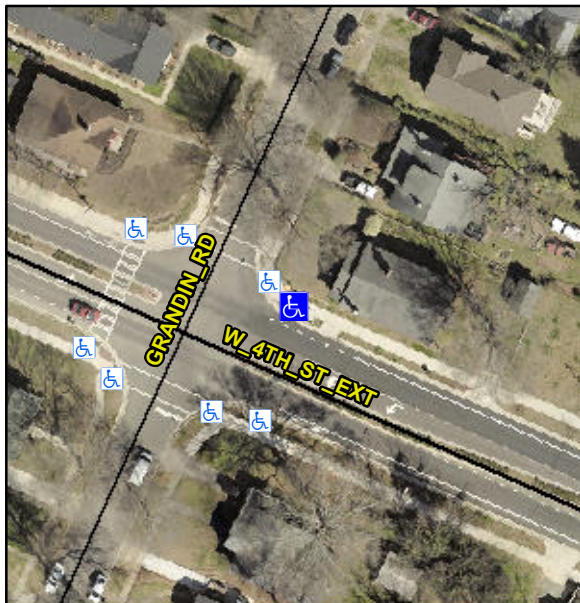