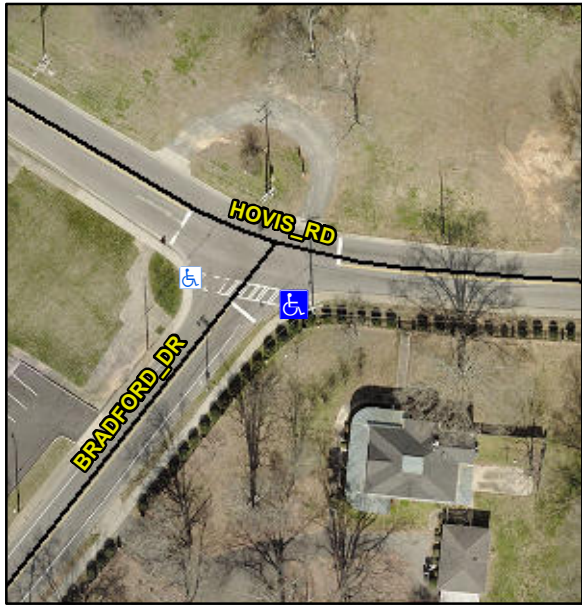


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8315	Main Street: BRADFORD_DR	Cross Street: HOVIS_RD	Location:	E
ADA ID: 43BEB513F2A4	Ramp Type: BlendTrans2	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 8.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	77.5	Yes	BlendTrans Slope (%)	2.0
			No	Ramp Width (in)	47.5	Yes	BlendTrans XSlope (%)	0.1
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
			N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Surveyor Notes:	CURB LIP 1.0, STOP SIGN & SIGNAL		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A			
			N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
			N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
				X Walk 1 Direction	To W		X Walk 2 Direction	N/A
				X Walk 1 Width (in)	94.0		X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	0.6		X Walk 2 Slope (%)	N/A
				X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
PROW/ADA:	R304.5.1			Road Slope (%)	3.2		Clear Space?	N/A
				Road X Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
				Obstruction Type			Storm Grate/Utility Type	
						N/A		N/A
						Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	3.9
						</		

