


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10037582	Main Street: SELWYN FARMS LN	Cross Street: N/A	Location: NW
ADA ID: 43D105479F12	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 25			

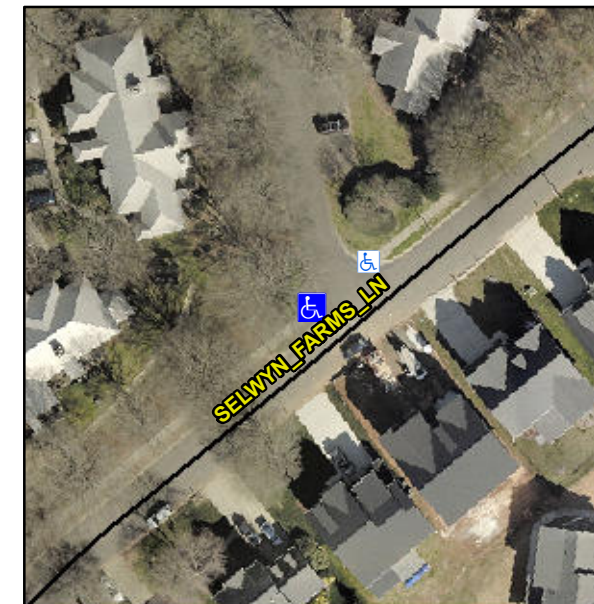

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R305.2, R302.7.2

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	33.0	Yes	Ramp Slope (%)	6.2
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.7	N/A	Flare Slope RT (%)	0.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	No
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.5
No	Landing X Slope (%)	N/A	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.5
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.3
No	Gutter Lip Ht (in)	1.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.1		X Walk 2 Slope (%)	2.3
	X Walk 1 X Slope (%)	3.4		X Walk 2 X Slope (%)	4.9
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2	N/A	Clear Space?	Yes
	Road X Slope (%)	5.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name SELWYN FARMS LN

Stop Condition-Street 2 None

Street 2 Name ENTRANCE

Stop Condition-Street 1 StopSign

