


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 45240	Main Street: BEGONIA_DR	Cross Street: BLAZE_MANOR_LN	Location:	N
ADA ID: 43D31868DCD5	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 12.5
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance		

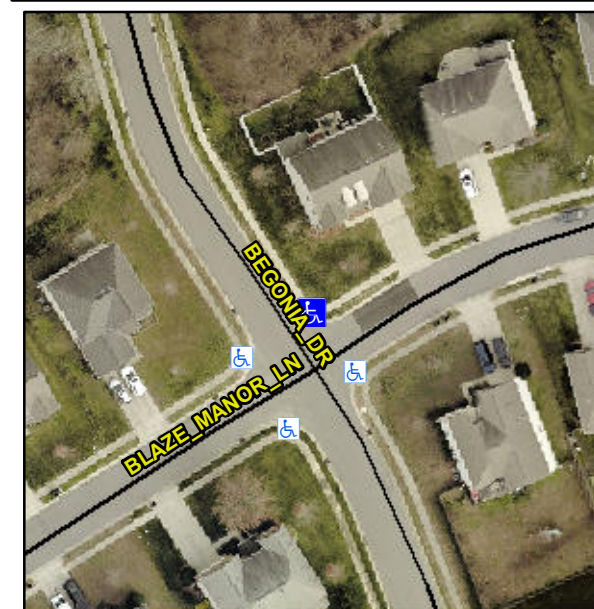

Possible Solutions:

Remove & Replace Curb Slope and Extend Ramp. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R302.7, R302.7.2, R304.5.4

Total Cost: \$ 2750.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	5.8
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	4.9	N/A	Flare Slope RT (%)	5.5
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	0.1	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	16.6
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.7		X Walk 2 Slope (%)	4.0
	X Walk 1 X Slope (%)	1.1		X Walk 2 X Slope (%)	1.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.9	N/A	Clear Space?	Yes
	Road X Slope (%)	2.9	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

