

## Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 23936 Main Street: CANDLEWYCK\_LN Cross Street: LAWTON BLUFF RD Location: SE

ADA ID: 43EC9A9C0BDA Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 21.25

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

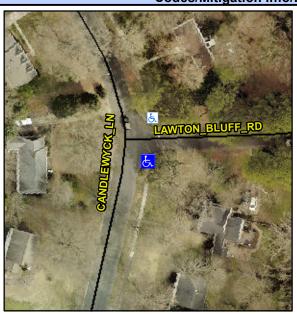

Street 1 Name
Stop Condition-Street 2
Street 2 Name
Stop Condition-Street 1

LAWTON BLUFF RD StopSign CANDLEWYCK LN None Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.1, R304.2.2

Total Cost: \$ 3200.00

Compliance Description <u>Data</u> Compliance Description Data No N/A Ramp Length (in) 65.0 Ramp Slope (%) 10.0 Yes Ramp XSlope (%) No Ramp Width (in) 46.5 8.0 N/A N/A Flare Type LT N/A Flare Type RT N/A N/A N/A N/A Flare Slope RT (%) N/A Flare Slope LT (%) N/A Flare Traversable LT? N/A N/A Flare Traversable RT? N/A N/A N/A N/A **DWS Provided?** N/A Landing Length (in) N/A Landing Width (in) N/A N/A **DWS Contrast?** N/A N/A N/A N/A Landing Slope (%) DWS Length (in) N/A N/A Landing X Slope (%) N/A N/A DWS Full Width? N/A N/A Landing Curb? (Y/N) N/A N/A DWS Offset (in) N/A N/A N/A Shared Landing? N/A Gutter Ponding? N/A N/A Gutter Slope (%) N/A N/A Gutter Lip Ht (in) N/A N/A Gutter X Slope (%) N/A N/A Painted X Walk1? No N/A Painted X Walk2? No X Walk 1 Direction To N X Walk 2 Direction To W N/A N/A X Walk 1 Width (in) X Walk 2 Width (in) N/A X Walk 1 Slope (%) X Walk 2 Slope (%) 7.1 3.1 X Walk 2 X Slope (%) X Walk 1 X Slope (%) 3.8 8.0 N/A N/A N/A Ramp inside XWalk2? N/A Ramp inside XWalk1? Road Slope (%) 7.7 N/A Clear Space? N/A N/A Road X Slope (%) 6.4 Clear Space to XWalk (in) N/A N/A N/A Any Obstructions? N/A Storm Grate/Utility Hazard? N/A **Obstruction Type** Storm Grate/Utility Type N/A N/A

Yes

Surface Condition? (G/P)

Good





