


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

|                                         |                            |                                         |                        |
|-----------------------------------------|----------------------------|-----------------------------------------|------------------------|
| Intersection ID: 13618                  | Main Street: S_CALDWELL_ST | Cross Street: TEMPLETON_AV              | Location: E            |
| ADA ID: 440E53895236                    | Ramp Type: Directional1    | Initial Pass/Fail: Pass                 | Overall Compliance: No |
| Codes/Mitigation Info/Possible Solution |                            | Field Measurements/Component Compliance |                        |
| Severity Score: 0                       |                            |                                         |                        |

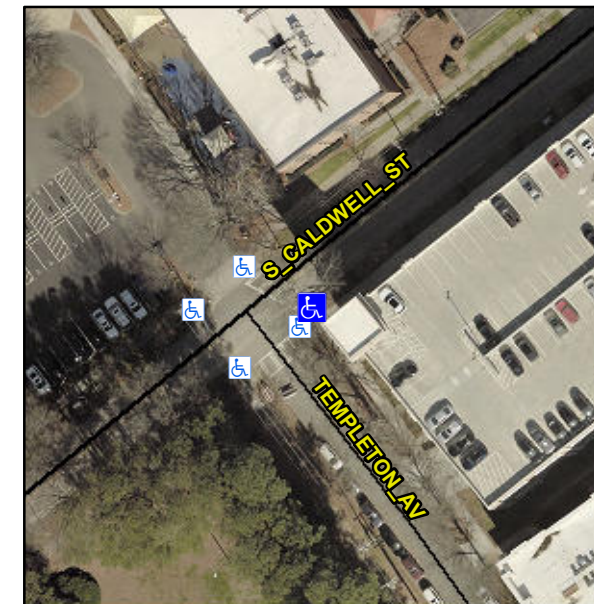

Possible Solutions:

**Remove & Replace Detectable Warning System.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R305.2**

Total Cost:

\$ 800.00

| Compliance | Description           | Data  | Compliance | Description                 | Data |
|------------|-----------------------|-------|------------|-----------------------------|------|
| N/A        | Ramp Length (in)      | 83.0  | Yes        | Grade Break?                | Yes  |
| Yes        | Ramp Width (in)       | 71.0  | Yes        | Grade Break Slope (%)       | 5.0  |
| Yes        | Ramp Slope (%)        | 5.0   | Yes        | Grade Break XSlope (%)      | 0.8  |
| Yes        | Ramp XSlope (%)       | 1.8   |            |                             |      |
| Yes        | Flare Type LT         | N/A   | Yes        | Flare Type RT               | N/A  |
| N/A        | Flare Slope LT (%)    | N/A   | N/A        | Flare Slope RT (%)          | N/A  |
| N/A        | Flare Traversable LT? | No    | N/A        | Flare Traversable RT?       | No   |
| Yes        | Landing Length (in)   | 89.0  | Yes        | DWS Provided?               | Yes  |
| Yes        | Landing Width (in)    | 71.0  | Yes        | DWS Contrast?               | Yes  |
| Yes        | Landing Slope (%)     | 1.8   | Yes        | DWS Length (in)             | 24.0 |
| Yes        | Landing X Slope (%)   | 1.9   | Yes        | DWS Full Width?             | Yes  |
| N/A        | Landing Curb? (Y/N)   | No    | Yes        | DWS Offset LT (in)          | 29.0 |
| N/A        | Shared Landing?       | Yes   | No         | DWS Offset RT (in)          | 12.0 |
| Yes        | Gutter Ponding?       | No    | Yes        | Gutter Slope (%)            | 2.2  |
| Yes        | Gutter Lip Ht (in)    | 0.0   | Yes        | Gutter X Slope (%)          | 1.9  |
| N/A        | Painted X Walk1?      | Yes   |            | Road Slope (%)              | 2.7  |
|            | X Walk 1 Direction    | To NW |            | Road X Slope (%)            | 1.8  |
|            | X Walk 1 Width (in)   | 117.0 |            | Clear Space?                | Yes  |
|            | X Walk 1 Slope (%)    | 2.7   | N/A        | Clear Space to XWalk (in)   | N/A  |
|            | X Walk 1 X Slope (%)  | 1.8   | Yes        | Storm Grate/Utility Hazard? | No   |
| Yes        | Ramp inside XWalk1?   | Yes   |            | Storm Grate/Utility Type    |      |
| Yes        | Any Obstructions?     | No    |            |                             | N/A  |
|            | Obstruction Type      |       | Yes        | Surface Condition? (G/P)    | Good |
|            |                       |       | N/A        | Curb Slope (%)              | 2.5  |

Street 1 Name S CALDWELL ST

Stop Condition-Street 1 None

Street 2 Name N/A

Stop Condition-Street 2 N/A

